

OAR 340-035-0035

Table 7

Existing Industrial and Commercial Noise Source Standards Allowable Statistical Noise Levels in Any One Hour

7:00 a.m. – 10:00 p.m.	10:00 p.m. – 7:00 a.m.
L ₅₀ – 55 dBA	L ₅₀ – 50 dBA
L ₁₀ – 60 dBA	L ₁₀ – 55 dBA
L ₁ – 75 dBA	L ₁ – 60 dBA



OAR 340-035-0035 Table 8

New Industrial and Commercial Noise Source Standards Allowable Statistical Noise Levels in Any One Hour

7:00 a.m. – 10:00 p.m.	10:00 p.m. – 7:00 a.m.
L ₅₀ – 55 dBA	L ₅₀ – 50 dBA
L ₁₀ – 60 dBA	L ₁₀ – 55 dBA
L ₁ – 75 dBA	L ₁ – 60 dBA



OAR 340-035-0035 Table 9

Industrial and Commercial Noise Source Standards for Quiet Areas Allowable Statistical Noise Levels in Any One Hour

	7:00 a.m. – 10:00 p.m.	10:00 p.m. – 7:00 a.m.
L ₅₀	50 dBA	45 dBA
L ₁₀	55 dBA	50dBA
L ₁	60 dBA	55dBA



OAR 340-035-0035 Table 10

Median Octave Band Standards For Industrial and Commercial Noise Sources Allowable Octave Band Sound Pressure Levels

Octave Band Frequency (Hz)	7:00 a.m. – 10:00 p.m.	10:00 p.m. – 7:00 a.m.				
31.5	68	65				
63	65	62				
125	61	56				
250	55	50				
500	52	46				
1000	49	43				
2000	46	40				
4000	43	37				
8000	40	34				

Sound Measurement Procedures Manual

NPCS - 1





REVISION RECORD

INSTRUCTIONS FOR USE: All revisions of this manual will be numbered to assure each manual holder that he has received all revisions. The date and initials of the person inserting revisions to the manual should be entered on this revision record opposite the appropriate revision number. If the sequence is broken, copies of the missing revisions may be requested from the Noise Control Section.

Rev. No.	Date Inserted	<u>Initials</u>
1.	1-30-74	and a man
2.	8-16-74	JH 4.5.6 # 314
3.	11-25-74	NJ NACZ -10-1 12-1
4.	8-27-76	JH Fac Amendoneals
5_	5-6-83	JOD Eac Amendments
6.		
7.		
8.		
9.		
10.		
11.		
12.		
13.		
14.		
15.		
16.		
17.		
18.		
19.		

FOREWORD

The Sound Measurement Procedures Manual has been prepared to specify the equipment to be used and the procedures to be followed when measuring environmental noise. The procedures established in the manual, when carefully followed, will ensure that the noise readings obtained are accurate, will support enforcement action, and aid in reducing environmental noise.

The scope of this manual includes industrial noise, commercial noise, noise from races and racetracks, noise from public roads and ambient noise measurements. Individual motor vehicle noise measurements are covered in a separate manual.

The objective of the manual is to establish procedures to implement the provisions of the Environmental Quality Commission. Further, if the practices and procedures herein are adhered to, the result will be a uniform enforcement program which will accomplish the intent of the Legislature and fulfill the Commission's responsibility under ORS Chapter 467.

Office of the Administrator Air Quality Control Division Department of Environmental Quality

TABLE OF CONTENTS

Chapter 1 -	INTRODUCTION	-
		Paragraph
	Policy	1.1
	Authority	1.2
	Instruments and Training	1.3
Chapter 2 -	INSTRUMENTATION	
	Sound Level Meters	2.1
	Accessories	2.2
	Tape Recorders and Level Recorders	2.3
	Octave Band Filter Sets	2.4
	Special Study Instruments	2.5
	One-Third Octave Band Filter Sets	2.6
	Impulse Meters	2.7
Chapter 3 -	INSTRUMENT CALIBRATION	
	General	3.1
	Battery Check	3.2
	Instrument Calibration	3.3
	Annual Calibration	3.4
Chapter 4 -	ENVIRONMENTAL NOISE MEASUREMENT	
	Application	4.1
	Site Selection	4.2
	Equipment Set Up	4.3
	Instrument Calibration and Battery Check	4.4
	Noise Level Measurement	4.5
	Statistical Noise Level Calculations	4.6
	Deleted	4.7
	Sound Laws Addustment with Distance	h 8

LIST OF FIGURES

FIGURE

	Measurement Point 25 feet from Building
	Measurement Point on Property Line
	Form NPCS-4
	Example Form NPCS-4
	Form NPCS-5
	Example Form NPCS-5
4-7	Form NPCS-29 One-third Octave Band Data Sheet
	Example Form NPCS-29 One-third Octave Band Data Sheet
4-9	Form NPCS-10-1 Statistical Noise Survey
4-10	Form NPCS-10-2 Statistical Computation Sheet
4-11	Form NPCS-10-3 Statistical Noise Graph
4-12	Example of Statistical Noise Survey on Form NPCS-10-1
4-13	Example of Computation Sheet on Form NPCS-10-2
4-14	Example of Statistical Graph on Form NPCS-10-3
4-15	Point Noise Source Distance Adjustment
4-16	Line Noise Source Distance Adjustment

CHAPTER 1

INTRODUCTION

Policy

- 1.1.1 The Department of Environmental Quality, through the Noise Pollution Control Section shall establish a noise measurement program to implement the laws and regulations applying to environmental noise.
- 1.1.2 The Noise Pollution Control Section shall be responsible for the conformity of environmental noise measurement.
- 1.1.3 This manual contains procedures for the Noise Pollution Control Section, and all other persons taking environmental noise measurements. Guidance is provided in the "Comments".
- 1.2 Authority

Statutory and administrative law governing authority to the guidance and direction contained in the following sources:

- a. Oregon Revised Statutes, Chapter 467, Sections 467.010, 467.020, 467.030, 467.040, 467.050, 467.990.
- b. Oregon Administrative Rules, Chapter 340, Division 35, Department of Environmental Quality.

Instruments and Training

1.3.1 Specific requirements for instruments and personnel are defined under procedure manual, Noise Pollution Control Section - 2, Requirements for Sound Measuring Instruments and Personnel.

CHAPTER 2

INSTRUMENTATION

Sound Level Meters

The specifications for sound level meters (SLM) are defined in manual Noise Pollution Control Section (NPCS-2) Requirements for Sound Measuring Instruments and Personnel. The minimum meter required is a Type II as defined by American National Standard Institute Number S1.4-1971.

2.2 Accessories

The minimum accessories shall be a windscreen and an acoustically coupled calibrator.

Comment: Additional accessories that have been found to be valuable in gathering data are tabulated below:

- (1) Noise data forms
- (2) Clipboard
- (3) Tripod
- (4) Wind meter
- (5) Sling psychrometer
- (6) Screwdriver
- (7) Spare batteries
- (8) Watch with sweep second hand or digital equivalent

Tape Recorders and Level Recorders

Recording systems shall conform to NPCS-2.

Comment: The recording system should be able to duplicate the measurements as taken in the field. For tape recorders, a table of frequency response tolerances is given in SAE standards. Graphic level recorder systems standards are also described in the manual.

Octave Band Filter Sets

The octave band filter sets shall be those defined in NPCS-2.

Comment: These sets may either be integral to a sound level meter or they may be a separate piece of equipment.

Special Study Instruments

Comment: In some instances, special types of equipment may be found to be useful in studying a noise problem. The Department has several specialized noise instruments to be used in study situations. These instruments include a random noise generator, a loud speaker system, and a one-third octave band filter set.

One-Third Octave Band Filter Sets

The one-third octave band filter sets shall be those defined in NPCS-2.

Comment: These sets may be integral to a sound level meter or they may be a separate piece of equipment. Sets shall contain the preferred one—third octave band filters.

Impulse Meters

Impulse meters shall be those defined in NPCS-2.

Comment: These meters are integral to some Type I precision sound level meters set for a peak unweighted response. Blasting impulse noise is measured on a standard Type I or Type II meter set to the "C" weighting scale and the "SLOW" dumping response.

NPCS1P -3-

CHAPTER 3

INSTRUMENT CALIBRATION

General

All types of sound level meters shall be field calibrated immediately prior to use, using the procedures described in the factory instruction manual.

Battery Check

Batteries in both the meter and the calibrator shall be checked before calibration.

Instrument Calibration

The instrument shall be set to the correct level range, weighting scale and meter response. The calibrator shall be placed on the microphone of the meter. The output indicated on the meter shall then be adjusted to the correct calibration level.

Annual Calibration

Within a year prior to use, each sound level meter, including octave band filter and calibrator, shall receive a laboratory calibration in accordance with the manufacturer's specifications. This calibration shall be traceable to the National Bureau of Standards.

Comment: An inspection label may be attached to each instrument set to determine when the calibration was performed.

CHAPTER 4

ENVIRONMENTAL NOISE MEASUREMENT

4.1 Application

This chapter applies to ambient measurements, noise emissions from industrial facilities, and commercial facilities, and to ambient noise limits from motor vehicles. Individual motor vehicle noise measurements, airports and racetracks are covered in separate manuals.

4.1.2 Persons selected to measure environmental noise shall meet the requirements of NPCS-2 Requirements for Sound Measuring Instruments and Personnel.

Site Selection

4.2.1 The measurement location shall be at any point, no more than 25 feet from the noise sensitive building where the noise level is generally greatest, as illustrated in Figure 4-1.

If the noise sensitive building is closer than 25 feet from the property line, the measurement location shall be at any point on the property line, providing it is no more than 25 feet from the building, or at any other point within the noise sensitive property no more than 25 feet from the noise sensitive building, wherever the noise level is generally greatest, as illustrated in Figure 4-2. For any measurement, sound reflective surfaces shall not be closer than 10 feet from the measurement point.

Comment: Sound reflective surfaces do not include trees, shrubs, hedges or other vegetation.

Comment: Measurements for noise sensitive property on which the noise sensitive building lies within 10 feet of the noise sensitive property line may require sound level projection techniques described in 4.8 of the manual.

Equipment Set-Up

- 4.3.1 The sound level meter or microphone, either hand held or placed on a tripod, shall be 4 feet or more above the ground or floor surface.
- 4.3.2 Comment: A microphone extension cable may be used in areas where accessibility is difficult. Example: Changes in ground elevation, reflective surfaces, height or source or receiver.

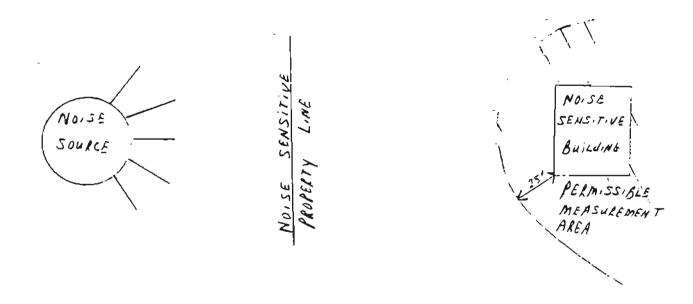


Figure 4-1 Measurement Point 25 Feet From Building

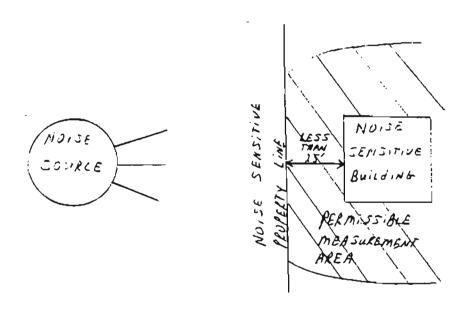


Figure 4-2 Measurement Point on Property Line

Instrument Calibration and Battery Check

4.4.1 Refer to Chapter 3 of NPCS-1 for instructions.

Noise Level Measurements

4.5.1 Comment: That information and data submitted to the Department should be recorded on Forms NPCS-4 and NPCS-5 as shown in Figure 4-3 and Figure 4-5, or on forms approved in writing by the Department.

4.5.2 Weather Conditions

- a. The wind speed and direction shall be determined before measurements are taken and recorded on a form. Measurements shall not be taken when the wind speed exceeds 10 mph. The sound level meter windscreen shall always be installed on the microphone while taking measurements.
- b. The relative humidity may be determined for the time measurements are taken. Measurements shall not be taken when precipitation affects results.

Comment: Measurements may be taken when the ground is wet if the readings are not influenced by motor vehicle tire noise on wet pavement.

c. Comment: The barometric pressure has an effect on the calibration level of most calibrators. This effect is usually small but can introduce some error under very low atmospheric pressure conditions or at high elevations. Typically no correction is needed at elevations below 2,000 feet. Above 2,000 feet elevation, the manufacturers correction factor must be applied to the instrument during calibration.

4.5.3 Determination of Meter Speed

a. Comment: The "FAST" meter speed is used for sounds of an essentially continuous nature. This speed is such that the indication instrument attains its final reading in approximately 0.2 seconds. In general, the "FAST" meter is used where meter fluctuations do not exceed 3 dB, or where the meter is required to follow fast changes in level such as an automobile or aircraft pass—by measurements.

b. Comment: The "SLCW" meter speed is used for sounds where the noise level fluctuates by + or - 3 dB and meter variations make the instrument display unreadable. The slower action of the meter provides an averaging effect that is helpful in measuring sounds of a rapidly varying nature or of low frequencies. However, for a noise pulse of 0.5 second duration, such a meter will typically read 2 to 6 dB low. It is not satisfactory for measuring intermittent sounds.

4.5.4 Weighting Scale Measurements

Comment: Maximum noise level measurements with the "A" network weighting scale are taken with the sound level meter switched to the "A" network per the manufacturer's instructions. The meter must be properly positioned with respect to the noise source per the manufacturer's instructions. Information and data taken during the measurements should be recorded on Form NPCS-4 or equivalent as shown in Figure 4-3.

4.5.5 Statistical Noise

Comment: The statistical noise level is that noise level exceeded a stated percentage of the time. An Lin = 65 dBA means that in any consecutive 60 minute period of the day 65 dBA is equalled or exceeded only 10% of the time, or for a total of 6 minutes. procedures are in use by the Department to determine statistical noise levels and other methods may be approved in writing from the Department. Three acceptable procedures to determine the statistical noise level are presented in Section 6 of this Chapter. Information and data taken during the measurements should be recorded on Form NPCS-10-1 or equivalent as shown in Figure 4-9. Statistical calculations can be carried out on Forms NPCS-10-2 and NPCS-10-3 and should be summarized in "L" terminology on Form NPCS-4. An example of a completed Form NPCS-4 is presented in Figure 4.4.

4.5.6 Ambient Noise Determination

Comment: The ambient noise level is a composite of sounds from many sources near and afar. As the ambient noise level will be compared to the noise level with the source included in any consecutive 60 minute period, it is important that data is obtained in time periods of interest during the day and also both the week and

the weekend to obtain data which are representative. It is also important to note that the data must be taken without emphasis on either noise peaks or unusual quiet.

Measurements should not be taken in weather conditions which may create a bias in the data. Wet streets or snow accumulations could bias the data unless these conditions are typical for the community.

Measurements should be made at least at several appropriate locations within the sampling area under consideration. Measurements should be made randomly in the sense that each location and each sampling time has the same chance of being sampled and that the selection of any one factor in no way influences the choice of another. Measurements should be made on at least three separate days.

The ambient statistical noise levels obtained or predicted with the noise source in question operating, should include all noises generated by that source. This may include such sources as increased motor vehicle traffic noise, safety warning device noise, and other sounds that may be exempted from the rules due to other considerations.

Procedures to determine the L10 and L50, statistical noise levels are presented in Section 6 of this Chapter. Information and data taken during the measurements should be recorded on Form NPCS-4 or equivalent as shown in Figure 4-4.

Octave Band Noise Measurement 4.5.7

Octave band noise measurements shall be made on an octave band frequency analyzer per document NPCS-2. Requirements for Sound Measuring Instruments and Personnel.

Comment: Octave band sound pressure levels may be measured in the same manner as the "A" weighting scale measurements, except that the octave band filters shall be used in place of the "A" weighting network. Information and data taken during the measurements should be recorded on Form NPCS-5 or equivalent as shown in Figure 4.5. An example of a completed form NPCS-5 is presented in Fig. 4-6.

4.5.8 Tape Recording

Comment: Tape recording of the noise and a calibration signal is optional. The tape recorder system must conform to the specifications defined in document NPCS-2 Requirements for Sound Measuring Instruments and Personnel.

4.5.9 One-Third Octave Band Noise Measurement

One-third octave band noise measurements shall be made on a one-third octave band frequency analyzer per document NPCS-2, Requirements for Sound Measuring Instruments and Personnel.

Comment: One-third octave band sound pressure levels may be measured in the same manner as the "A" weighting scale measurements, except that the one-third octave band filter shall be used in place of the "A" weighting network. Information and data taken during the measurements should be recorded on form NPCS-29 or equivalent as shown in Figure 4-7. An example is shown in Figure 4-8.

4.5.10 Impulse Measurements

Impulse measurements shall be made on meters per document NPCS-2, Requirements for Sound Measuring Instruments and Personnel. Impulse sound pressure levels are to be taken with the meter set to the linear unweighted scale with the peak detector circuit engaged for unweighted (dB) impulse measurements. For "C" weighted (dBC) impulse measurements the meter is set to the "C" weighting scale and the meter speed is set to the "SLOW" damping response.

Comment: Information and data should be recorded on Form NPCS-4 or equivalent as shown in Figure 4-3. An example of a completed form is presented in Figure 4-4.

DEPARTMENT OF ENVIRONMENTAL QUALITY

		SOU	ND PRES	SURE" LE	VEL DATA	SHEETS	_			· · ·	
							C	ounty			
OURCE					_			_	BY		
•								_ 04	ATE		
								_ SI	!EET		
	_							- [INC	TRUMEN	
OMPLAINANT _	_	_						-		1	
								_		TYPE	25KT
COMPLAINT DAT	E							_	SLM		,
	_								MIC		
Time Ck.	Cal.	°F dry	°F we		Press.	Wind mph	Wind Direct		CAL	<u>' </u>	
CK.	1 45		Quito	1 1		iil y fi	Direct	 [
									Wind	screer	ON O
	i				. [<u> </u>			
Measurement Position			A Scale	C Scale	Linear Scale		L ₁₀	L ₅₀		Peak mpulse	
.											
								, .			
	·					-			#		
									ĺ	İ	
	k	·				u .			•		
_											
Comments				_							
Comments			_								
Comments											

		i			
			1. Days of Operation	5,	Tisibility to Source
			A. Man Eri.		A. Direct
			S. Mon Sac.		3. Hill or Serm
		!	C. Mon Sun.		C. ====================================
	INSTRUMENT SET-UP CHECK-OFF LIST		2. Time of Operation		0. Other
			A. 8 a.z 5 p.z.	٤.	Zaning
_			3 4.3 p.a.		A. Residence
	Site Selection	ري ا	1. Stumber of Shifts		3. Plant of Facility
	SIM Position		A. One	7.	Who case first?
	Battery Check		8. THO		A. ResidenceJace
	Calibration Adjustment		C. Three		3. Plant or Facility
Ξ		1	4. Distance from Receiver to	9.	Perision Submitted
<u></u>	Wind Below 10 MPH	1	source feet.		A. Yes Number
	Humidity Below 95%				1. Vo
					•-
<u> </u>	Windscreen	30			
		11			
		H			

SKETCH OF MEASUREMENT SITE AND SOURCE

REVERSE SIDE FORM NPCS-4 FIGURE 4-3

DEPARTMENT OF ENVIRONMENTAL QUALITY

			SOUR	אט ספבככ	3105. LI	EVEL DATA	SHEETS		File	<u>Indus</u>	try
			_		וטאב בו	LILL UNIĂ	JIILLIJ	C	County	Multino	mar
SOURCE			Pavino			· 			_	84 <u>C.M.</u>	Srcku
	1000	SE	10	1 st , T	Portla	<u>unal</u>			OA	TE <u> </u>	74
Rock	cru	sher				_			SH	EET _//	2
				_	_					INSTRUME	
COMPLAI	NANT _	Mr.	<u>Eastle</u>	and					_	. 1	<u>}.</u>
155	SE	Mill	man I	Dr. Po	Hlan	d			_	EQT TYPE	SERIAL
COMPLAI	NT DATE	51	10/74						-	SLM 15453 MIC 1 GR	-
	1 .		200		~ ~		1			FLTR	Ī
Time	Bat. Ck.	Cal. dB	°F dry bulb	°F wet	% RH	Press. mm Hg	Wind mph	Wind Direct	<u> </u>	CAL GR	1916
1,450	/	114	67	51	29	_ 	0.5	W		1	400 055
								!	 	Windscree	ON OFF
)						i		
- 		Τ	4	· 1		•		_	Γ	 	
Measur Posi		1	leter :/Slow	A Scale	C Scale	Linea e Scale		¹ 10	¹ L ₅₀	Peak Impulse	
-	J	-		- 70		85				156	
,	1	fils	<i>σ</i>	78		85		-	_	1 /2 4	
- 6	γ	firs	, †				79	75	70	{	
}				_							
					•					II	
	<i>^</i>			/	ia -	1	- دام	1.	<i>L</i>	درسی د 1	
									ict.	10 15c	
Li re	iccit	C12	ISIEC	<u>cperu</u>	CTING	15 4	71-5/	<u>a154,</u>			
-							_				
					7014 C	orm NPCS-	Λ				

	Mon Fri.	(A.) Direct
	S. Mon Sac.	3. Hill or Bern
INSTRUMENT SET-UP	C. Men Sun.	C. Trees
CHECK-OFF LIST	2. Time of Operation	0. Other
	λ. 8 a.m 5 p.m.	6. Zoning
Site Selection	(a) (a s.s 9 s.a.	(A.) Residence
	1. Number of Shifts	3. Plant or Facility
SIM Position	A. One	7. Who came first?
Sattery Check	(3) Two	A Residence Jate
Calibration Adjustment	C. Three	3. Plant or Facility
Wind Below 10 MPH	4. Distance from Receiver to	3. Perition Submitted
	source 3/x)-3ff Zsec.	(A) Yes Mumber 3CO Ski
Rumidity Below 95%		1. %
☑ Windscreen		
· ·		

5. Visibility to Source



Mr. Eustland
Residence

| Compared Acise Sensitive Property

Example Form NPCS-4
Figure 4-4 REVERSE SIDE FORM

DEPARTMENT OF ENVIRONMENTAL QUALITY


			SC	DIND	PRES	SURE	LEV	EL D	ata si	REETS		Fil	ie		
												Count	у		
SOURCE -													YB		
			_										DATE _		
													TEBHZ		
TOMBLAT:	IAMT					_							ins	TRUMEN	TATION
OMPLA I	(AIII)												ΈΩΤ	TYPE	SERIAL
COMPLA IN	T SATE												SLM		
JOHN CHIL							_						MIC		
	Bat.	Cal.	9F (iry	3 F W	æt	2	Pre	ess.	Wind	Wind	i	FLTR		
Time	Ck.	dB	bu l	16 ⁻	bul	ь	RH	(रहारे		mph	Oire		CAL		
	_												- bnik!	screen	ON CEF
													'		
													_		
Position			A Scale		in. ale	31 8:		63 Rz	125 Hz	250 Hz	500 H2	1000	2000 Hz	4000 Hz	8000
							\dashv			_					
				•											
						_									
					•	-	-			-			<u> </u>		
-				-				-							
mments															
						_		•							
				_		_									
						Fo	ו ווויונ	IPCS-	5				-		


SKETCH OF MEASUREMENT SITE AND SOURCE

FIGURE 4-5 REVERSE SIDE FORM NPCS-5

DEPARTMENT OF ENVIRONMENTAL QUALITY

		so	OUND PRES	SURE L	EVEL D	ata si	REETS		Ft1	e <u></u>	indu	stry
									Count	y 14	نم:	
SOURCE _	Sani	5 Sa	wmill									<u>- 505</u>
	200 F		_							DATE	41.27	174
	4400			_						SHEET	•	,
	Ĵ											
COMPLAINA	INT (Y)			ڪائير						INS	TRUMEN	MOTATION
COMPLAIN					جوزر و ا	مندن				EQT	TYPE	SERIAL
	1:.U	<u> </u>	-lin 51	10716	J					SLM	G.R.	320 <2/
COMPLAIN	DATE	API	1 19,	1914						MIC		2000
	0-5	1 96	ا عدا		0		112 - 4	1111	1	FLTR	G. 2.	್ಪಕ್ಷವಿ
Time	8at. Ca Ck. dB	I. °F (iry °F (ess. Hg	Wind mph	Hine Oir	- 1	CAL	G. 2.	50
3:40 ===	JK //	+ 6	1 51	4	-	-	4	u)			
4:07 Jan	CK 114	0								Hind	screen	ON CFF
	1			101 0		1	1 700		_			10000
Position	Fast/ Slow	A Scale	Lin. Scale	31.5 H2	63 Hz	125 Hz	250 Ez	500 Hz	1000 Hz	2000 Hz	4000 Elz	8000 Hz
1	5	47	63	55	55	54	54	50	44	38	7.0	٠٠نو
		+										
				<u> </u>			-					
				+		\vdash	+		 			
				,								
Comments	Mena	1 L M P 1	אין ואינוץ	tak	en i	dur	ing "	الماط	" ٢٠٠٠			
Comments _	0,000	rtir	REA	divos	·	Yen	Frank	.1				
	3/51	have	h 11'	122	001		., .,					
	<u> </u>		<u> </u>	<i>∪</i> ∝	11,1	•						

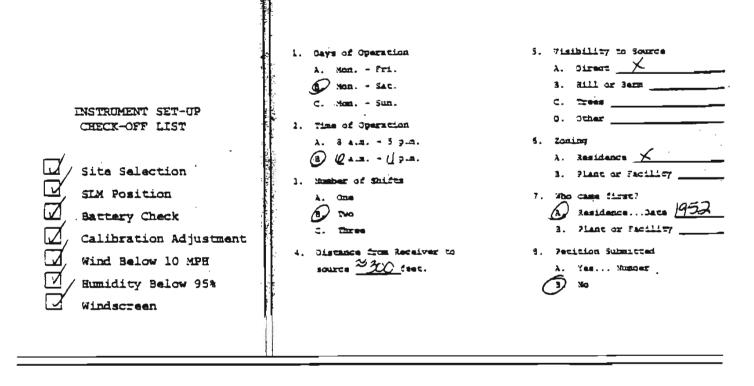

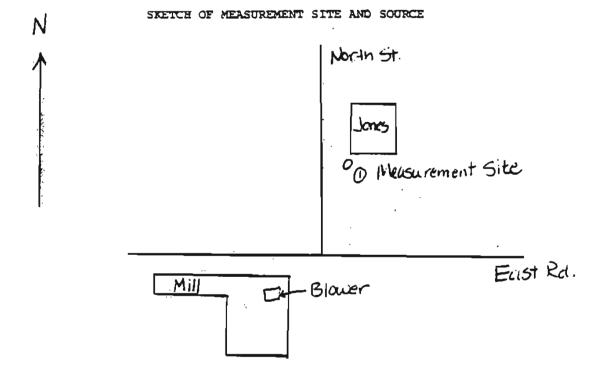

Example Form NPCS-5 Figure 4-6 REVERSE SIDE OF FORM

DEPARTMENT OF ENVIRONMENTAL QUALITY

1/3 OCTAVE BAND DATA SHEET

											File			
OURCE											County 			
											D.	ATE		
							_		_		s	HEET		
	14 NT						_				_ 1	INST	RUMENT	ATION
.UMPLA11											_ (EQT	TYPE	SERIAL
OMOLATI	WT DATE	•									— <u>[</u>	SL'4		
OMPLAT:	ii unic	·									— ¦		į	
Time	Bat.	Cal.	°F d	ry of	wet	3						-		
ıme	Ck.	48	buil	b 8	ou l b	RHI	mm Hg	<u> - } me</u> -	<u> </u>	Direc	<u>t </u>	<u> </u>		
												Winds	creen	אט מרד
			Ì											
		PRE	FERRED	CENT	FR FRF	מוודיום	TES FO	R 1/3	CCTAVI	E BAHOS	:			
Lin.	20	- 25	30	40	50		_				T	250	315	400
Scale	Hz	Hz	Hz	Hz.	Hz	Hz	Hz	Hz	Hz	Hz	Hz	Hz	Hz	Hz
					· .									
							·							
500	630	800	1000	1250	1600	2000	2500	3150	4000	5000	6300	8000	TO 000	12 500
			1000						7333	5555	0000	3303	10,000	12,500
	<u> </u>	_		<u> </u>										
·										-				_
												L		
	OMPLAIN OMPLAIN Time Lin. Scale	OMPLAINANT OMPLAINT OATS Time	OMPLAINANT OMPLAINT OATS Time	OMPLAINANT	OMPLAINANT OMPLAINT DATE Time	OMPLAINT DATE Time	OMPLAINT DATE Time	OMPLAINT DATE Time	OMPLAINANT OMPLAINT DATE Time	OMPLAINT DATE Time	OMPLAINANT OMPLAINT DATE Time	OMPLAINANT OMPLAINT DATE Time	OURCE	OURCE

DEPARTMENT OF ENVIRONMENTAL QUALITY

					1/3	OCTAVE	8AND	DATA	SHEET			File	NP-	ABC	LUMB
Ş	SOURCE _		3 <u>C</u>		1BE		<u>Co.</u>		····	·				HAMM	
			05						. /			_ · _	··· <u>-</u>		
•	COMPLAIN	(ANT	MR	. Jo) E	Smi	TH					- [[NST	RUMENT	ATION
		1	24.	5 "I	51 5	Ìτ.,	Coc	5 E	AY			<u> </u>		4 - V	SERIAL
ı	COMPLA I	T DAT	<u>9</u>	-16	- 81					.		— 	MIC	B+K 1	39 <mark>6 472</mark> 311 347 923111
Í	Time	Bat. Ck.	Cal. dB 124,0	bull bull	b b	wet uib RTLY!	% RH	Press		ind :	Wind Direct	===	CAL	B+K	376042 704619
	3:10FM		124.0			11				-4!	- 11				ON OFF
	Lin.	20 Hz	25 Hz	FERRED 30 Hz	CENTI	ER FRE	QUENC:	IES FO	R /3	CCTAVE	34MDS 160 Hz	200 Hz	250 Hz	31.5 Hz	460 32
1	70	58	60	59	58	59	60	59	59	58	57	56	54	52	
						, ,	. ,								
Position	500	630	800	1000	1250	1600	2000	2500	3150	4000	5000	6300	8000	 [
1	50	48	46	45	53	43	41	40	40	37	38	36	37	32	28
				-											
Comments	_SAI A LA														
BA	N.D.	_						3000							

- 4.6 Statistical Noise Level Calculations
- 4.6.1 Hand Sample Method (Comment)
 - a. For this method use forms NPCS-10-1, NPCS-10-2, and NPCS-10-3 as shown in Figures 4-9 through 4-11 or equivalent.
 - b. Perform a short noise survey to determine the approximate range of sound levels produced by the noise source being investigated. Enter the approximate high and low noise levels as well as the central tendency on form NPCS-10-1. Use the minimum and maximum sound levels and the table at the back-bottom of form NPCS-10-1 to estimate the minimum number of good sound samples needed to be taken from the source in question. For example, in Figure 4-12 the noise varied from a high of approximately 67 dBA to a low of 61 dBA. This is a 6 dBA variation. The table on NPCS-10-1 indicates that a minimum of 132 good readings needs to be taken.

The table on NPCS-10-1 is designed to give an acceptable statistical confidence in the L_{10} and L_{50} noise level. For determining the L_{1} noise level with confidence or for more complex noise sources, more noise samples than indicated in the table may be necessary.

- c. Record the noise levels in dBA on Form NPCS-10-1 at five second intervals, at ten second intervals, or at fifteen second intervals. An example of such a measurement is presented in Figure 4-12. Note any unusual activity from the noise source in question. Also indicate all external or extraneous noise sources which may contaminate the noise reading. Examples include sounds from passing vehicle traffic and aircraft. The sound readings associated with these external sources will not be included in the statistical noise level calculations. If external sounds contaminate the measurements for a significant amount of time, it may be necessary to conduct the survey during a period of the day in which these other sources are absent or quieter.
- d. Using Form NPCS-10-2, tally the recorded noise levels in 1 dBA increments as the example shows in Figure 4-13. Record on NPCS-2 only those sound levels which are legitimately associated with the source in question, ignoring all other contaminating sound levels.

In the "Number of Readings" column, sum the total readings at each dBA level. Using the "Number Greater Than" column, calculate the number of readings taken that are greater than each particular level. For example, in Figure 4-13 there are no readings greater than 74 dBA, hence the "Number Greater Than " is zero. There is one reading taken at a level greater than 73 dBA, and three (1 plus 2) readings greater than 72 dBA.

The percent greater than (\$ Greater Than) column contains the statistical percent for each dBA level. The percent is calculated by dividing the numbers in the "Number Greater Than" column by the total number of readings times 100. For example, the percent of 73 dBA is calculated as (1/194) x 100 = 0.5\$, and the percent at 72 dBA is (3/194) x 100 = 1.5\$.

e. Using Form NPCS-10-3, the dBA levels versus the "percent greater than" numbers are plotted. An example of this is shown in Figure 4-14.

From the resulting graph, the statistical noise level at any required percentage may be found. For example, the L_{50} and L_{10} are found to be 63 dBA and 66 dBA, respectively. Note that a normalized or randomly varying noise source will result in a straight line when plotted on form NPCS-10-3.

- f. The results from the statistical survey are then summarized on form NPCS-4 (see Figure 4-4). On the back of NPCS-4 a sketch of the measurement site should be drawn.
- g. A typical noise survey will require approximately 20 minutes of measuring to record the required number of samples at a 5-second sample interval. However, the noise standards for industrial and commercial noise sources (OAR 340-35-035) are specified for a one-hour (60 minute) period. Therefore, the noise investigator must ensure that the noise survey represents sounds that are typical of a full 60-minute operation of the noise source. If the source significantly changes its operation for the remainder of the hour, it is recommended that a full 60 minutes of samples are measured and recorded for the statistical analysis.
- h. The documentation of the L₁ statistical noise level is often better accomplished by the "time above" method. For noise sources that operate for a short period of time at a constant sound level, an accurate determination of the L₁ noise level can be determined by measuring the total amount of time the noise source operates in a one-hour period. If

the source operates for a period of 36 seconds or greater within the hour (but less than 6 minutes), then the L_1 is equal to the measured noise level. If the source operates for 6 minutes or more during the hour, then the measured level is the L_{10} statistical noise level.

4.6.2 Noise Exposure Counter or Monitor Method

Comment: Statistical noise levels may be obtained through the use of several commercially designed devices that sample and classify the data.

4.6.3 Programmable Calculator Method

Comment: The noise staff of the Department has developed a program to calculate statistical noise levels on a Wang 600 series programmable calculator. This method will digitally make the necessary calculations after the analog noise data has been converted to digital data. As this method is specialized to the Department's facilities, it will not be presented here. A complete explanation of the method and program listing is on file at the Department in Manual NPCS-22, Analysis of Ambient Noise with the Wang 600 Series Programmable Calculator.

DEPARTMENT OF ENVIRONMENTAL QUALITY STATISTICAL NOISE SURVEY

SOURCE	: .								DATE:		
									BY:		
MEACUE	CMC	WT CITE							COUNTY		
MEASUR	CEME	MI ZIIE:							_		/
	T 7	Č-1dhaa				Dunna	1 11d	1,145 - 4	SHEET:		
Time	į.	Calibra- tion dB	dry bulb	wet bulb	%RH	Press.	Wind MPH	Wind direct.			NTATION
										TYPE	SERIAL
	\vdash								SLM		,
	_	_	Hit	1	.OW		Central	Tend.	MIC		,
∼ Ra	enge	of Nois	e:	dBA		_dBA			CAL		
Start			. Sa	mp la					MINDS	יחכבא	:ON OFF
Time			In	terval:	5	10 1	l5 sec	onds	PLEIFOZI	ZKEEN	ON UFF
DATA	POI	NTS			SOUN	D PRESSU	JRE LEVE	L dBA	_		
1 -	6										
7 -	12										_ •
13 -	- 18										
19 -	- 24						1				
25 -	- 30										
31 -	- 35			`			. `		_		
37 -	- 42				, ,,		<u>`</u> .				
43 -	- 48								•		
47 -	- 54										·
55 -	- 60										
61 -	- 66				<u> </u>						
67 -	- 72		, · · ·								
73 -											
79 -							<u> </u>			—	
85 -					_						
91 -		277	40,500	•	-						
97 -			1-62/7		igapha			`		↓	
103					 			·			,)
109			1944/4019		1		· _			<u> </u>	
115					Fig	gure 4-	∍、 [′] —		,	 	
121				Fo	rm .	IPCS-10	<u> </u>			₩	
127	- 1	32	`				_	·		1	

Indicate all missing data points and give an explanation. NPCS-10-1 Note: See back for the minimum number of samples.

					1			
133 - 138								
139 - 144					<u> </u>			
145 - 150								
151 - 156				-				
157 - 162								
163 - 168								
169 - 174								
175 - 180								
181 - 186				<u> </u>				
187 - 192			-					
193 - 198								
199 - 204	<u> </u>				1			
205 - 210								
211 - 216								
217 - 222				<u> </u>	<u> </u>			
223 - 228								
229 - 234								
235 - 240								
241 - 246	·							
247 - 252								
253 - 258								
259 - 264								
265 - 270	1				<u> </u>			
271 - 276	4							
277 - 282								
283 - 288								
289 - 294					1			
295 - 300			-					
301 - 306								
307 - 312								
313 - 318								
319 - 324			iguro 4-2					
325 - 330		Reverse :	igure 4-9 Side Form n	NPCS-10-1_				
331 - 336								
	Maximum	- Minimum L	evels (diffe	rence in ran	nge)			
0-8 9	1 10 11	1 12 13	14 15	16 17		19	20	21
132 138	174 210	246 288	336 384	438 498		618	684	756
		Minimum Nu	mber "Good"		. '			
								

Indicate all missing data points and give an explanation. Additional data points may be needed to document an L_1 violation. Note: NPCS-10-1

		rce:			No Gre ter	re ter
e ve ±BA	1: [77 . 11]	20	30	40	leadings han	Tran
1		1				
•	1					
				4 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1		
-						
	1 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1					1
						-
						1
						1
				<u> </u>		ļ ļ
						<u> </u>
						<u>[</u>
						1
			 			1
		+ '+ '+ '				
		<u> </u>	Jure CS			
		┋ ╉╂╄╂╴	1111			
		+		┩┩┩┡		
			1111			

Ī			Τ.	. [I		<u>8</u>
	dBA	d ₿A	d BA			<u> </u>	┥╸┾╌╶┷		1 1 1	1 1 1 1	11:		111	<u> </u>	1		<u> </u>	<u> </u>	-
	· =	ا ھ	₽ _l		1		1		1					1		-	!		_
					===				* * *			7.		1—					٦ .
				٠.			1 : 1		()	i i	1 1				1		7.7		7
		1	.			1111				111	. , ,		3	_			<u> </u>	, -	_ _{&} ;
			.		711	1111	1	 	+++	1: :	1111	1111	1	1 1 1		1	-		, 9/
	f	4							11	1,1					-	‡	+		4
		ı	. 1				Statement Co.										141		'
	·	_ <u>;</u> e	L ₅₀ :	,					1 1	: 1	1 1 2								-
		_			-1											1	77		_;
	!				1.11	<u> </u>		1 1 1		1000	i '	1111		_	LL.	<u></u>			٠
	٠,	111										1 .		_ بإ					
			1 1 1		1 1 1	11		1 1 1		1	1 1 1	,		4	1				<i>— ₽</i> ;
نے		1 1	1								1 1 1			-					
-					 	1			-								<u> </u>		_
							FIE								<u> </u>				
			\equiv																-i
		1=	=	===											-	<u>1 . i . i</u>			4
		1								1			 -		-				1
		- - +						-1		7	-1								┪
		:-1		- 77			1:::	1	1.41	<u>L</u> .	<u> </u>		7:::	1::::	Γ				-
						1 .											ī		_
				-	<u> </u>								<u> </u>		<u> </u>				-{ \$
			-						. E . E	EE	===		=				:: -		_
		-		==		-	-: ^:	13 55			==			::					~
						2.4		11::::	.511.5				.E . :	1777					_
ļ		E				1			,4,,,,,,,,,,,,,,,,,,,,,,,,,,,,,,,,,,,,					12:	-		i		'
				1	 		· · · · ·		- 	-									
	== :":	<u> </u>												1::2:	.:				_
			1:							====									
			 	-		 	52.2.1								ــــــ				≺
			-		1	F	1	==					- -		-		:		
			1		1 1 1	111		341	李亮	95. 1.5.	7 1				<u> </u>		-		<u>!</u>
URCE		-	111		1	 	111		100		1111			l	-				'
=		,			1		†	1			-1;;		1 1 1		Ì				
		+			.===		222											<u>;:</u>	
								7			-+-1-		-			Sar A.			1
							11							,			==	==	<u>.`</u>
						1 1 1							111	7 × 7		-]	~
		+	1 1		1 - 1 1	- • • -		+++		111	1111		1131		, .	: 1	├─	1	ļ
	<u> </u>	 -	1			17	1111		112		, i	67).		111		 		72:	- '
	. —	1	1.272.17		1 1 1	1111	11111	Lii		[]!!	[[titi	htt:		111	147.1.1		!]=	<u> </u>	-
		+==:						F	Fían	re 4	-11							===	=
		1.1			4 4 4 4 4	1:1-	+:+ :::	l _				_	 			- -	1		4
				7 7 7 7	+++ +-	┡┊┼┷┌	1	F	OIM	NPCS	-10	- J				 	 	† 	4
						拼		ļ., '		NPCS		-			, 14, 17.				1


	DATE: 9-16-81
1581 S.W. 76TH (DEBARKER, SAW, CHIPPER)	BY: GTW
	COUNTY: MULT.
1576 S.W. 76 TH, PORTLAND	SHEET: 2/4
Time tion dB dry bulb rmm Hg. MPH direct.	INSTRUMENTATION
1410 V 114.0 0-5 NW	EQUT TYPE SERIAL
1515 V 114.0 2-6 NW	SLM 1565 12345
HI Low Central Tend.	MIC 1"
\sim Range of Noise: 67 dBA 61 dBA 63 dBA	CAL 1987 1790
Start Time: 1420 PDT Sample Interval: (5) 10 15 seconds	WINOSCREEN TON OFF

OATA BOINTS		- .	COUNT DEFEN	מב ו בטבו שמי		
DATA POINTS	k -		SOUND PRESSU	-		- ا - ا
1 - 6	65	63	62	61	64	65
7 - 12	63	61	65	CAR	CAR	64
13 - 18	63	62	70	65_	,63	62
19 - 24	70	62	DOG	64	63	61
25 - 30	62	43	63	61	67	67
31 - 36	TRUCK -	→ T	T	64	66	65
37 - 42	62	63	64	63	62	64
43 - 48	63	63	64	63	73 R	62
47 - 54	63	63	۵5	62	64	63
55 - 60	61	64	65	63_	43	65
61 - 66	45	66	64	61	62	66
67 - 72	40	61	63	63	64	70
73 - 78	72	61	73 R	74 R	64	64
79 - 84	63	62	60	65	62	64
85 - 90	61	62	67	63	JET	JET-
91 - 96	JET	JET	65	64	64	64
97 ~ 102	70 R	63	64	63	62	65 .
103 - 108	66	65	66	62	64	63
109 - 114	64	64	62	43	45	64
115 - 129	64	67	63	64	Dog	DOG
121 - 126	65	. 66	67	64	66	69
127 - 132	69	CAR	CAR	63	66	64

-	Ţ ·, - !	 	·. <u>-</u>			
133 - 138	63	66	65	64	63 .	66
139 - 144	62	63	65	4	63	64
145 - 150	64	64	65	66 .	62	64
151 - 156	66	63	68	63	63	63
157 - 162	62	43	. 44	٤3	63	62_
163 - 168	63	65	64	62	. 63	68
169 - 174	- COMF	LAINANT	TALKIN	G	64	61
175 - 180	63	63	63	64	63	<u>65</u>
181 - 186	64	61	61	BIRDS-	→ B ·	<u> </u>
187 - 192	64	63	64	62.	45	64
193 - 198	62	64	63	62	64	62
199 - 204	CAR	CAR	63	64	60	63
205 - 210	64	62	62	TRUCK-	→ ⊤	7
211 - 216	T	\top	+	63	64	64
217 - 222	69	63	65	63	65	63
223 - 228				_		-
229 - 234						
235 - 240						
241 - 246						
247 - 252				-		
253 - 258						
259 - 264						
265 - 270						
271 - 276			•			
277 - 282						**
283 - 288						
289 - 294						
295 - 300						
301 - 306						
307 - 312						
313 - 318						
319 - 324						
325 - 330						
331 - 336						
	Maximum	- Minimum L	evels (diffe	rence in ran	ne)	

	Maximum - Minimum Levels (difference in range)												
0-8	9	10	LII	12	13	14	15	16	17	_18	19	20 21	
132	0-8 9 10 11 12 13 14 15 16 17 18 19 20 21 132 138 174 210 246 288 336 384 438 498 558 618 684 756												
	Minimum Number "Good" Samples												

Date	-16-81 Source: ACME WOOD PRODUCTS INC.	_ Sheet	14
Level ÆA	1420 PDT	Greater Readings Than	5re∍
76			
75		0.	
74		1-0	0
73		2 1	0.5
72		1 3	5
7		0 4	
70		4 4	2
69		3 8	4.1
48		2 11	57
67		5 13	6.7
6		2 8	93
65		23 30	5 5
64		46 53	273
43		53 99	5 0
<u>62</u>			78.4
61		2 7 9	
(p)		3 9	98 5
59			.}
58			-
00			
1			
1	1 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1		7
	gure		1
	Example Form NPCS -2		S
÷			N
			1
	Martin Liling Addition (1.2)		

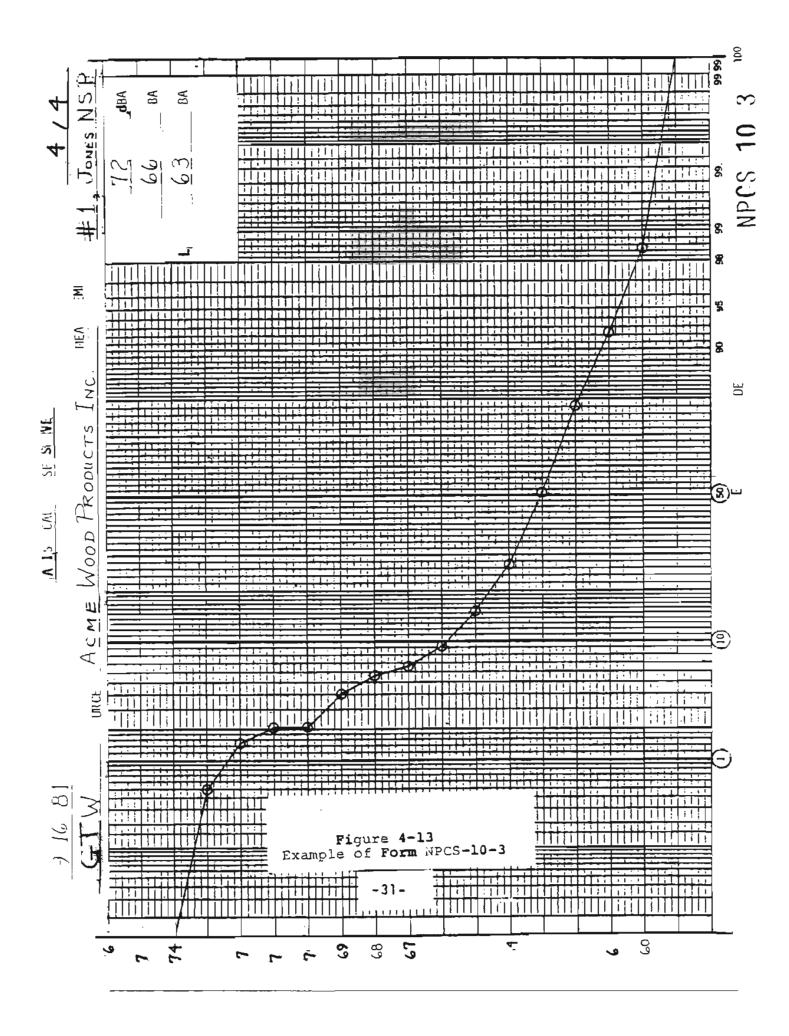

4.8.1 Point Source

Comment: The sound pressure level at a point r feet from a point source can be calculated from a sound pressure level measurement at a point ro feet from the point source using the following equation:

$$SPL = SPL - 20 \log (r/r_0)$$


where:

SPL = sound pressure level at r feet from the source.

SPL_O = sound pressure level at r_O feet from the source. Note that r_O is a reference distance and that the distance r is always greater than r_O. The point r_O must be in the far field of the source.

Figure 4-15 illustrates a point source, such as an industrial site, and the distance at which the measurement SPLo is taken and the distance where the required level. SPL is needed.

This projection technique is applicable only if the distance between r and r_0 is less than 1000 feet. This projection technique should be used only when it is not practical to make a sound pressure level reading at r.

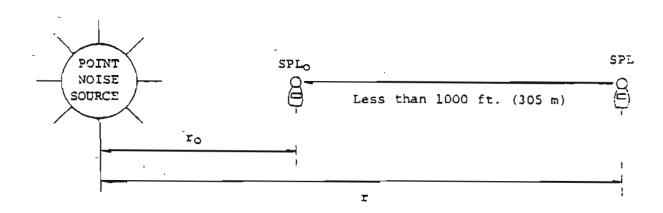

SOUND LEVEL ADJUSTMENT WITH DISTANCE

FIGURE 4-15

NPCS1P

4.8.2 Line Source

Comment: The sound pressure level at a point r feet from a line source can be calculated from a sound pressure level measurement at a point r₀ feet from the line source using the following equation:

$$SPL = SPL_0 - 10 log (r/r_0)$$


where:

SPL = sound pressure level at r feet from the source.

SPLo = sound pressure level at ro feet from the source. Note that ro is a reference distance and that the distance r is always greater than ro. The point ro must be in the far field of the source.

Figure 4-16 illustrates a line source, such as a highway with closely spaced moving vehicles, and the distance at which the measurement, SPL_O is taken and the distance where the required level SPL is needed.

This projection technique is applicable only if the distance between r and r is less than 1000 feet. This projection technique should be used only when it is not practical to make a sound pressure level reading at point r.

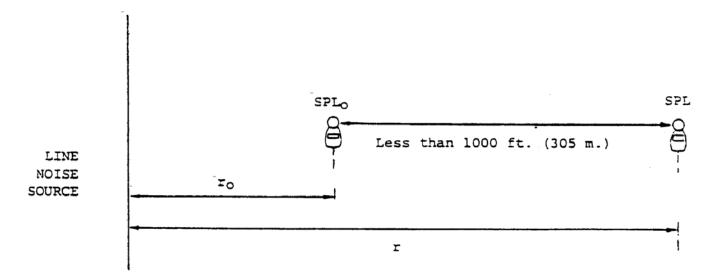

LINE NOISE SOURCE DISTANCE ADJUSTMENT

FIGURE 4-16