

Oregon Department of Environmental Quality - Underground Storage Tank Program
Technical Compliance Inspection - UST Inspection Report (Temporary Closure)

Inspector: Diana Foss

Date: April 23, 2024

Time: 11:00 am

Facility: 9891

I. Site Information					
Facility Name: Petroluem Energy Products			Permittee: Ralph Jenne		
Site Address: 182 NE C St.			Organization: Petroleum Energy Products, Inc.		
City: Willamina			Phone: (971) 237-1627		
II. Tank Information					
DEQ Permit #	AJGKG	AJGKH	AJGKJ	AJGAK	
Estimated Gallons	12000	12000	12000	12000	
Substance	Diesel	Gasoline	Diesel	Diesel	
Tank Material	Cathodically protected steel	Cathodically protected steel	Cathodically protected steel	Cathodically protected steel	
Tank Install Date	8/10/1982	8/10/1982	8/10/1982	8/10/1982	
Pipe Material	plastic	plastic	plastic	plastic	
Pipe Type	pressure	pressure	pressure	pressure	
Pipe Install Date					
Overfill Device	alarm	alarm	alarm	alarm	
Objective of field visit: FCI					
Notes and Comments from the UST database: <i>x Check file before conducting inspection</i>					
III. Financial Responsibility Compliance ☐ Yes ☒ No					
Type of coverage: none		Begin Date:		End Date:	
Coverage amount correct:		Number of tanks covered:			
Financial responsibility could also be in the form of self insurance, bonds, local government, trust fund, and or guarantee					
IV. Corrosion Protection Compliance ☐ Yes ☒ No					
x Cathodic		☐ Galvanic		x Impressed Current	
				☐ Fiberglass/composite tanks	
Steel tank with cathodic?		x Yes		☐ No	
Steel pipes with cathodic?		☐ Yes		x No	
Steel flex-lines with cathodic?		☐ Yes		x No	
Date of cathodic test: _____					
Last two tests available?		☐ Yes		x No	
Did last test pass?		☐ Yes		☐ No	
If not:					
Was failed test reported to DEQ?		☐ Yes		☐ No	
Was system repaired?		☐ Yes		☐ No	
Date of repair? _____					
Cathodic retested within 6 mos. of repair?		☐ Yes		☐ No	
Date of retesting? _____					
If impressed current system:					
Rectifier Operational?		☐ Yes		x No	
Rectifier log maintained?		☐ Yes		x No	
Rectifier been operating continuously		☐ Yes		x No	
x Tank Lining					
Date of last test? 5/14/2008					
Pressure test conducted after tank lining inspection?		☐ Yes		☐ No	

V. General notes from inspection

Representative onsite: Mrs. Jenne

email: _____

Concrete had been torn up "in preparation for decommissioning." 30 day notice submitted 5/27/19, not in database. No proof of ICC exam. No 3 day notice. No FR, no CP records, site not secured, TC expired 6/18/2020

Compliance Determination: ☐ No Violations Observed ☐ Observed violations resulting in enforcement

Inspector Signature: _____

Date: _____

FCI Exp

Submitted by: diana.foss_deq

Submitted time: Apr 23, 2024, 1:33:31 PM

Facility Number


9891

Address

182 Northeast C Street, Willamina, OR, 97396

Map

Lat: 45.078627 Lon: -123.484373

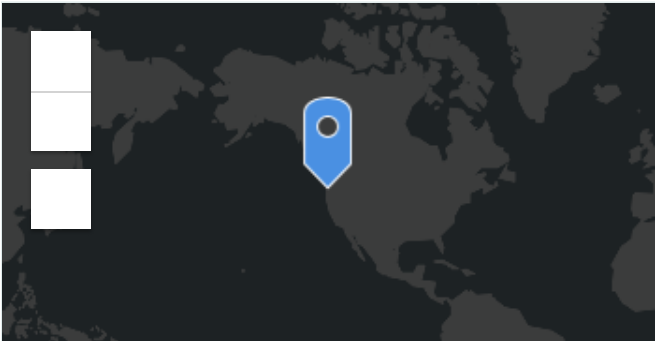

Esri, FAO, NOAA, USGS

Powered by Esri

Date

Apr 23, 2024

Compliance Determination

Corrosion Protection

Fail

Spill Prevention

Pass

Overfill Prevention

Pass

Release Detection

Pass

Operator Training

Fail

Financial Responsibility

Fail

Walkthrough Requirements

Pass

Photos





photos-20240423-111742.jpg



photos-20240423-111747.jpg



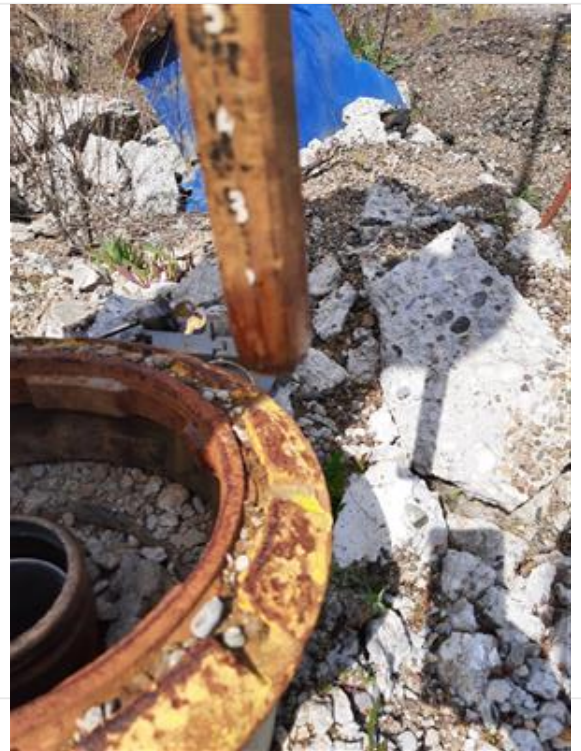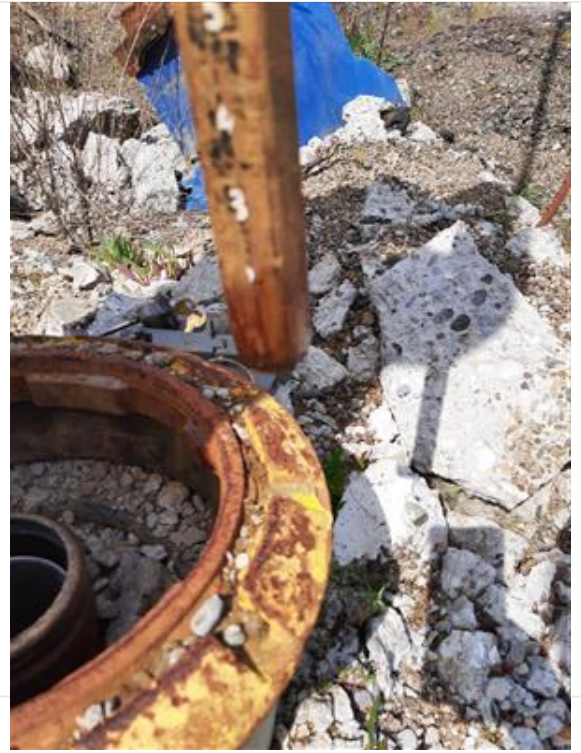



photos-20240423-111829.jpg



photos-20240423-111833.jpg



photos-20240423-111838.jpg



photos-20240423-111842.jpg