



# Oregon

Tina Kotek, Governor

Department of Environmental Quality

Northwest Region

700 NE Multnomah Street, Suite 600

Portland, OR 97232

(503) 229-5696

FAX (503) 229-6124

TTY 711

August 15, 2025

Canby Food Market  
Daljit Singh  
293 SW 1<sup>st</sup> Ave  
Canby, OR 97013

RE: UST Compliance Inspection  
**DEQ UST# 1207 – 293 SW 1<sup>st</sup> Ave**

Dear Canby Food Market:

The Oregon Department of Environmental Quality (DEQ) is conducting underground storage tank (UST) inspections throughout Oregon. The purpose of this letter is to inform you that your facility, among others, has been selected for inspection. A thorough inspection of your facility will be conducted to determine compliance with state and federal UST requirements. **The date you receive this letter is the date that the inspection starts.** If you have work done after that date, you will need to have the previous set of records available for evaluation in addition to the most recent records.

**The inspection for this facility is scheduled for September 9, 2025, starting at approximately 11 am at the DEQ UST # listed below. Please confirm receipt of this notification.**

**September 9, 2025**

**DEQ UST # 1207 – 293 SW 1<sup>st</sup> Ave, Canby at 11 am**

Please note that the inspection will require uninterrupted participation and attendance by you or a knowledgeable assistant. For the inspection you need to provide access to tank sumps, under dispenser areas, cathodic protection rectifiers, and leak monitoring equipment. DEQ will not touch the equipment or enter the facility, if you are unable to assist with equipment access, please have your UST Service Provider there. This inspection may also include review of Stage I Vapor Recovery.

DEQ staff will not assist with operating tank gauges or the opening of sumps and dispensers.

**The DEQ requests the following documentation be submitted electronically prior to the inspection:**

- Line and leak detector testing results for the past three years,
- Monthly tank leak detection records, one year's worth
- Class A, B, and C training documentation,
- Financial responsibility mechanism,
- Annual tank gauge certification, last three years
- Last two tests of Spill prevention testing records, was due to start testing in 2020
- Monthly walkthroughs,
- Last two tests of Overfill Prevention Equipment testing, was due to start testing in 2020
- Cathodic protection testing (if applicable).

Please submit these records to [ingrid.gaffney@deq.oregon.gov](mailto:ingrid.gaffney@deq.oregon.gov) for review. If these records cannot be submitted prior to the inspection, please have them available for review at the facility.

Owners must also be able to operate the tank gauge and print out applicable reports such as the tank setup and in-tank alarm reports. Owners also must be able to sound high fill over alarm from the tank gauge, if applicable.


DEQ will not touch any equipment, if you are unable to assist with equipment access, please have your UST Service Provider there. DEQ will need to observe what equipment is in the tank top sumps and under the dispensers. If ball floats are the primary overflow protection device, these will need to be verified during the inspection, please be able to locate and remove the ball floats.

If violations are found at the time of the inspection without prior notification, DEQ is required to initiate enforcement action. For UST violations, enforcement usually begins with a field citation option, which is much like paying a traffic ticket and making corrections.

Some enforcement situations including repeat violations will go through a longer and more formal process including civil penalties.

Thank you for your cooperation. I can be reached at 503-875-1264 [ingrid.gaffney@deq.oregon.gov](mailto:ingrid.gaffney@deq.oregon.gov) to answer any questions you may have and assist you in the preparation for your inspection.

Sincerely,

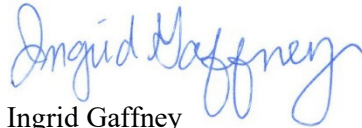

Ingrid Gaffney  
UST Compliance Specialist  
Northwest Region

Oregon Department of Environmental Quality - Underground Storage Tank Program  
 Technical Compliance Inspection - UST Inspection Report

PE  
 02/25/25  
 ydo

Inspector: Ingrid Gaffney

Date: 9/9/2025

Time: 11AM

Facility: 1207

**I. Site Information**

Facility Name: <u>Canby Food Market</u>	Permittee:	Contact: <u>SATTA Rocky Singh</u>
Site Address: <u>293 SW 1st Ave</u>	Organization:	Phone:
City: <u>Canby, OR 97013</u>	Phone:	<u>503-851-5419</u>

**II. Tank Information**

DEQ Permit #	CJAH	CJAJ	CJBA		
Estimated Gallons	<u>10000</u>	<u>10000</u>	<u>10000</u>		
Substance	<u>GAS</u>	<u>GAS</u>	<u>DIESEL</u>		
Tank Material	<u>OWENS CORNING Single Wall</u>	→			
Tank Install Date	<u>5/9/1980</u>	→			
Pipe Material	<u>Emviron</u>	→			
Pipe Type	<u>pressure</u>	→			
Pipe Install Date	<u>5/9/1980</u>	→			
Overfill Device	<u>Alarm</u>	→			

**Notes and Comments from the UST database:**

Check file before conducting inspection

If tanks are manifolded, which tanks:

**III. Operating Certificate**

Compliance  Yes  No

Current  Accurate  Posted for delivery drive to observe

**IV. Operator Training**

Compliance  Yes  No

Class A/B Operator  Yes  No Name: Gurjot Singh Date: 5/1/2024

Class C Operator  Yes  No  Cardlock

**V. Financial Responsibility**

Compliance  Yes  No

Type of coverage: insurance Begin Date: 6/4/2025 End Date: 6/4/2026

Coverage amount correct: \$1,200,000 Number of tanks covered: 3

Financial responsibility could also be in the form of self insurance, bonds, local government, trust fund, and or guarantee

**VI. Walkthrough Requirements**

Compliance  Yes  No

Spill prevention and release detection equipment checked monthly?  Yes  No

Tank top sumps checked annually?  Yes  No

VII. Release Detection

Compliance

Yes

No

a) Annual Release Detection Operability Testing (Sometimes referred to as Tank Gauge Certification)

Date of last testing: 3/3/25 4/15/2024 Last three tests available?  Yes  No  
4/26/23

b) Piping Release Detection (Check all that apply)

Pressurized Piping

ATG is not functioning

Mechanical Leak Detector (MLLD)  Electronic Leak Detector (ELLD) - check for swiftcheck requirement

Date of last testing: 3/3/25 4/15/24 Last three tests available?  Yes  No  
4/23/23  
 Number of lines tested: 3 Number of LD tested: 3

Leak detector manufacturer make and model: 99LD2000

Tank gauge manufacturer make and model: EVO OPW Fuel Management

MLLD on turbine manifold?  Yes  No  
 MLLD product appropriate? (Example, diesel Red Jacket FX series on diesel system?)  Yes  No  
 If ELLD and no line testing: Annual 0.1 gph results from tank gauge?  Yes  No

Interstitial Monitoring

[Monthly records must include, date system was checked, observations made, initials of person checking. Electronic records must include power status (on or off), alarm indication status (yes or no) and sensor malfunction notes (yes or no).]

Date of last sump testing: \_\_\_\_\_ Last two tests available?  Yes  No

Date of last sensor testing: \_\_\_\_\_ Last three tests available?  Yes  No

Float sensors installed correctly?  Yes  No  
 Interstitial space opened to sump?  Yes  No  
 Presence of water in sumps?  Yes  No

Safe Suction

Check valve directly below suction pump?  Yes  No

c) Monthly Tank Release Detection (Check all that apply)

Tank Gauge  CSLD  SCALD  Static  
 Are correct tank sizes programmed at tank gauge?  Yes  No  
 Tank diameter/length seem appropriate?  Yes  No  
 Are tanks manifolded?  Yes  No  
 If so, tank gauge testing setup for manifolded tanks?  Yes  No

If Veeder Root tank gauge leak detection  
 CSLD set at 99%  
 Thermal coefficient set correctly?  
 (Gasoline 0.00070; Diesel 0.00045)  
 If Incon/Franklin tank gauge leak detection  
 If SCALD is Vol Qual set to 14% (or 99% confidence)  
 Is API gravity set correctly?  
 (Regular 63.5; Plus 62.8; Super 51.3; Diesel 32.8)  
 For all tank gauges doing static tests  
 (Static tests require tank to be 50% full for a valid test)

Interstitial Monitoring [Monthly records must include, date system was checked, observations made, initials of person checking. Electronic records must include power status (on or off), alarm indication status (yes or no) and sensor malfunction notes (yes or no).]

SIR Ensure pass or fail results within 30-day period. Inconclusive result means release detection requirement not met

Tank release detection records available during inspection None

T1: <u>2025</u>	<input type="checkbox"/> Jan	<input type="checkbox"/> Feb	<input type="checkbox"/> Mar	<input type="checkbox"/> Apr	<input type="checkbox"/> May	<input type="checkbox"/> Jun	<input type="checkbox"/> Jul	<input type="checkbox"/> Aug	<input checked="" type="checkbox"/> Sep	<input type="checkbox"/> Oct	<input type="checkbox"/> Nov	<input type="checkbox"/> Dec
T2:	<input type="checkbox"/> Jan	<input type="checkbox"/> Feb	<input type="checkbox"/> Mar	<input type="checkbox"/> Apr	<input type="checkbox"/> May	<input type="checkbox"/> Jun	<input type="checkbox"/> Jul	<input type="checkbox"/> Aug	<input type="checkbox"/> Sep	<input type="checkbox"/> Oct	<input type="checkbox"/> Nov	<input type="checkbox"/> Dec
T3:	<input type="checkbox"/> Jan	<input type="checkbox"/> Feb	<input type="checkbox"/> Mar	<input type="checkbox"/> Apr	<input type="checkbox"/> May	<input type="checkbox"/> Jun	<input type="checkbox"/> Jul	<input type="checkbox"/> Aug	<input type="checkbox"/> Sep	<input type="checkbox"/> Oct	<input type="checkbox"/> Nov	<input type="checkbox"/> Dec
T4:	<input type="checkbox"/> Jan	<input type="checkbox"/> Feb	<input type="checkbox"/> Mar	<input type="checkbox"/> Apr	<input type="checkbox"/> May	<input type="checkbox"/> Jun	<input type="checkbox"/> Jul	<input type="checkbox"/> Aug	<input type="checkbox"/> Sep	<input type="checkbox"/> Oct	<input type="checkbox"/> Nov	<input type="checkbox"/> Dec
T5:	<input type="checkbox"/> Jan	<input type="checkbox"/> Feb	<input type="checkbox"/> Mar	<input type="checkbox"/> Apr	<input type="checkbox"/> May	<input type="checkbox"/> Jun	<input type="checkbox"/> Jul	<input type="checkbox"/> Aug	<input type="checkbox"/> Sep	<input type="checkbox"/> Oct	<input type="checkbox"/> Nov	<input type="checkbox"/> Dec

**VIII. Spill Prevention** Compliance  Yes  No

Date(s) of testing: 4/15/24 3/5/21 Number of spill buckets tested? 3  
 Did spill bucket pass most recent testing?  Yes  No If no, was spill bucket replaced/repaired?  Yes  No  
 During inspection, visual damage to spill bucket?  Yes  No  
 Hydrostatic testing (test takes one hour to complete)  
 Vacuum test (test takes 1 minute, ending vacuum must be 26 inches water column or greater)

**IX. Overfill Prevention** Compliance  Yes  No

Date(s) of testing: 4/26/23 3/5/21  
 Overfill device pass most recent testing?  Yes  No If no, overfill device replaced?  Yes  No  
 Overfill method that was tested:  Alarm  Flapper  Ball Float  
Overfill Alarm  
 Alarm sounds when tank is 90% full  Yes  No  
 Driver can see or hear alarm at point of transfer?  Yes  No  
 Sound alarm from tank gauge during inspection?  Yes  No  
Flapper Valve  
 Testing verified the valve automatically restricts flow at 95%  Yes  No  
 Visual observation of flapper on day of inspection?  Yes  No  
Ball Float  
 Testing verified the ball float automatically restricts flow at 90%  Yes  No  
 Visual observation of ball float during inspection?  Yes  No

*ATG not functioning but operator stated it does work.*

**X. Corrosion Protection** Compliance  Yes  No

Cathodic  Galvanic  Impressed Current  
 Steel tank with cathodic?  Yes  No  
 Steel pipes with cathodic?  Yes  No  
 Steel flex-lines with cathodic?  Yes  No  
 Date of cathodic test: \_\_\_\_\_  
 Last two tests available?  Yes  No  
 Did last test pass?  Yes  No  
 If not:  
 Was failed test reported to DEQ?  Yes  No  
 Was system repaired?  Yes  No  
 Date of repair? \_\_\_\_\_  
 Cathodic retested within 6 mos. of repair?  Yes  No  
 Date of retesting? \_\_\_\_\_  
 If impressed current system:  
 Rectifier Operational?  Yes  No  
 Rectifier log maintained?  Yes  No  
 Rectifier been operating continuously  Yes  No  
 Tank Lining  
 Date of last test? 3/25/2014  
 Pressure test conducted after tank lining inspection?  Yes  No

XI. General notes from inspection

Representative onsite: ~~Satinder~~ ~~Shukla~~ email: sipboy@gmail.com

200 Rocky Singh Canbyfoodmart@gmail.com  
\* EVO Franklin is not on correct date nor was it

\* No has product like in bottom not violation, filter change.  
- LO reports

Violation

- EVO Franklin was not programmed correctly or operating correctly.
- NO Monthly leak detection reports.

Compliance Determination:  No Violations Observed  Observed violations resulting in enforcement

Inspector Signature: Ingrid Gaffney Date: 9/9/2025



**OREGON DEPARTMENT OF ENVIRONMENTAL QUALITY  
INSPECTION PHOTOLOG**

**FACILITY NAME: Canby Food Market #1207  
INSPECTION DATE: September 9, 2025**

Facility Name: Canby Food Market

### UNDERGROUND STORAGE TANK OPERATOR MONTHLY WALKTHROUGH CHECKLIST

**I. FACILITY INFORMATION**

Business Name (Same as Facility Name or DBA-Doing Business As): CANBY FOOD MARKET

Business Site Address: 293 SW 3<sup>RD</sup> AVE City: CANBY, OR ZIP Code: 97013

**II. UNDERGROUND STORAGE TANK OPERATOR INFORMATION**

Name of UST Operator: \_\_\_\_\_ Phone #: \_\_\_\_\_

Name(s) Class A/B Certification: \_\_\_\_\_ Class A/B Certification Date: \_\_\_\_\_

Year: 2025

	N/A	Jan	Feb	Mar	Apr	May	Jun	Jul	Aug	Sep	Oct	Nov	Dec
Is tank monitor/automatic tank gauge (ATG) (VeederRoot, Incon, etc.) powered on and in proper operating mode?		Yes	Yes	Yes	Yes	Yes	Yes	Yes	Yes	Yes			
Has each leak detection alarm been responded to appropriately? Provide comments in sections VII and VIII on the back page if there have been any alarms.		Yes	Yes	Yes	Yes	Yes	Yes	Yes	Yes	Yes			
Are you maintaining monthly documentation (printouts) from your tank monitor / ATG (Veeder Root, Incon, etc.) with passing results?		Yes	Yes	Yes	Yes	Yes	Yes	Yes	Yes	Yes			
Is the tank monitor / ATG providing a passing printout for 0.2 gph or are you keeping liquid status sensor printouts? Keep at least one per month.		Yes	Yes	Yes	Yes	Yes	Yes	Yes	Yes	Yes			
Are dispenser nozzles, swivels, hoses, breakway connectors in good condition and free of leaks?		Yes	Yes	Yes	Yes	Yes	Yes	Yes	Yes	Yes			
Are spill buckets free of damage for each tank? (No cracks, buldges or holes, no water or debris, etc.)		Yes	Yes	Yes	Yes	Yes	Yes	Yes	Yes	Yes			
Are fill pipes free of obstructions for each tank?		Yes	Yes	Yes	Yes	Yes	Yes	Yes	Yes	Yes			
Is the fill cap secure on the fill pipe for each tank?		Yes	Yes	Yes	Yes	Yes	Yes	Yes	Yes	Yes			
Are the under-dispenser containment (UDC) free of damage, water, debris and hazardous substance?		Yes	Yes	Yes	Yes	Yes	Yes	Yes	Yes	Yes			
Have you visually checked turbine containment sumps for damage or leaks to the containment <u>on annual basis</u> ?		Yes	Yes	Yes	Yes	Yes	Yes	Yes	Yes	Yes			
Initials of person conducting walkthrough inspection:													
Date of walkthrough inspection:		Jan 31	Feb 28	Mar 31	Apr 30	May 31	Jun 30	Jul 31	Aug 31	Sept 30			
	Y	N	NA	Date									
Has the tank monitoring system certification been completed within the past 12 months (i.e. annually)? (if the date is more than 12 months, schedule with your contractor to perform testing.)													
Has spill bucket testing been completed by a contractor within the past 36 months (i.e. 3 years)?													
Has the overflow device (e.g. ball float, alarm, flapper) been inspected by a contractor within the past 36 months?													
Has the turbine sump/UDC testing been completed by a contractor in the past 36 months?													
Has the corrosion protection (CP) system been tested by CP contractor within the past 36 months?													
Is the pollution prevention insurance policy period of 12 months still valid?													

**1: Monthly walkthroughs**

### MECHANICAL LEAK DETECTORS TEST RESULTS

DATE: 3-3-2025  
Company Performing Test: Petroleum Compliance Service LLC  
Tech: Kenneth Pike  
Client: Daljit Singh  
Site Name: Canby Food Market - #1207  
Address: 293 SW 1<sup>st</sup> Ave, Canby, OR 97013

Product Type: Regular Unleaded  
Type of Leak Detector: Vaporless 99 LD-2000  
Type of line Tested: Environ  
3GPH TEST Results: **FAILED** ✓  
Replaced Leak Detector: YES  
If Yes Type of new replacement: Vaporless 99 LD-2000 Retest: **PASSED**

Product Type: Premium Unleaded  
Type of Leak Detector: Vaporless 99 LD-2000  
Type of line Tested: Environ  
3GPH TEST Results: **PASSED**  
Replaced Leak Detector: NO  
If Yes Type of new replacement: Retest:


Product Type: On-Road Diesel  
Type of Leak Detector: Vaporless 99 LD-2000  
Type of line Tested: Environ  
3GPH TEST Results: **PASSED**  
Replaced Leak Detector: NO  
If Yes Type of new replacement: Retest:

Product Type:  
Type of Leak Detector:  
Type of line Tested:  
3GPH TEST Results:  
Replaced Leak Detector:  
If Yes Type of new replacement: Retest:

**2: Line Leak Detector testing**




3: EVO 200 Franklin data is incorrect for dates

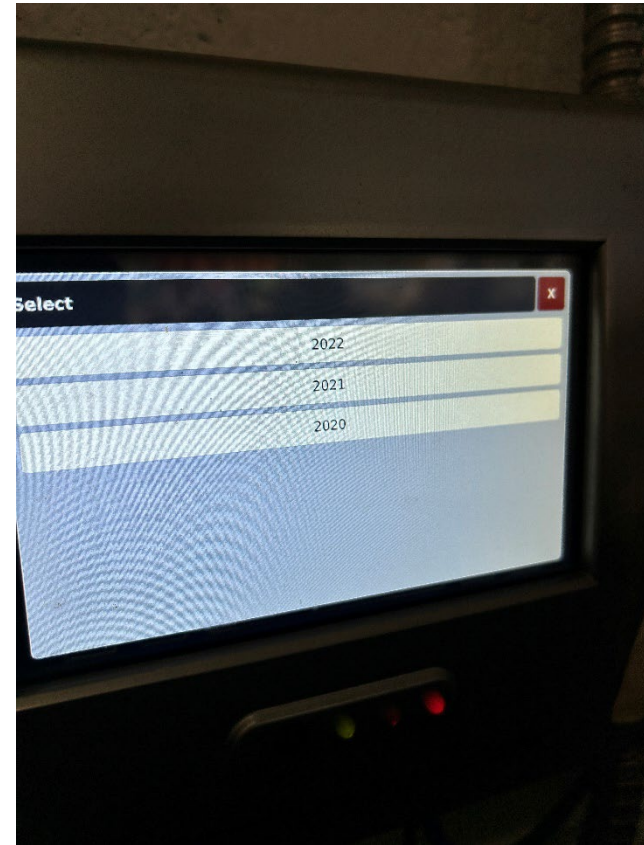


4: EVO Franklin years and dates are incorrect



5: No access to set up report

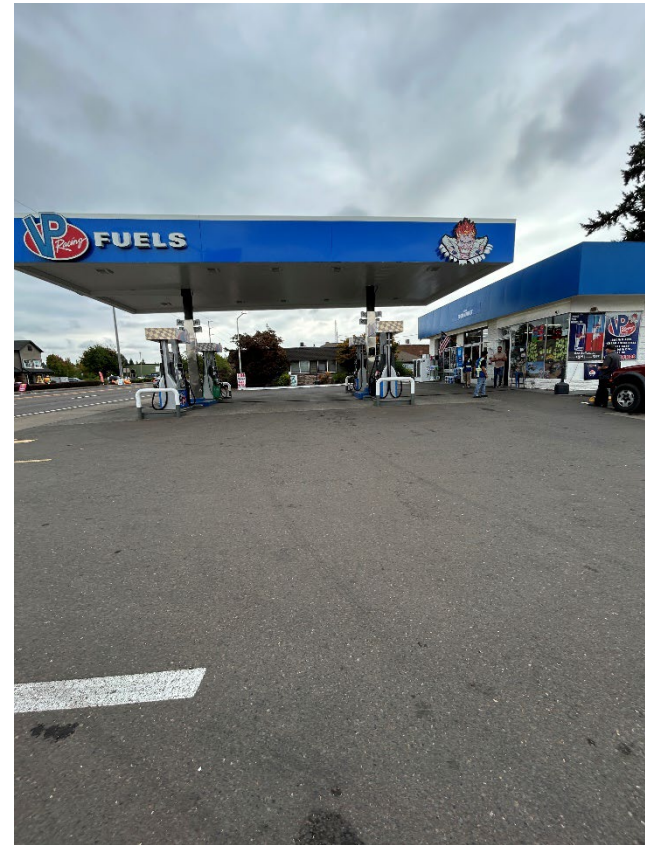

6: 293 SW 1<sup>st</sup> Ave, Canby, OR 97013

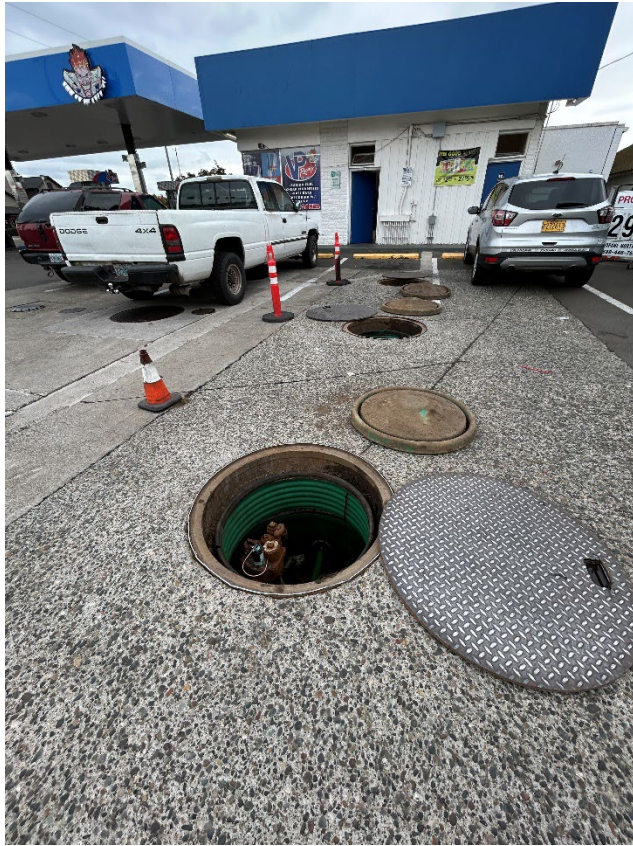


7: Tank nest looking north




8: Clean premium fill with coaxial drop tube



9: Tank gauge probe for clean premium

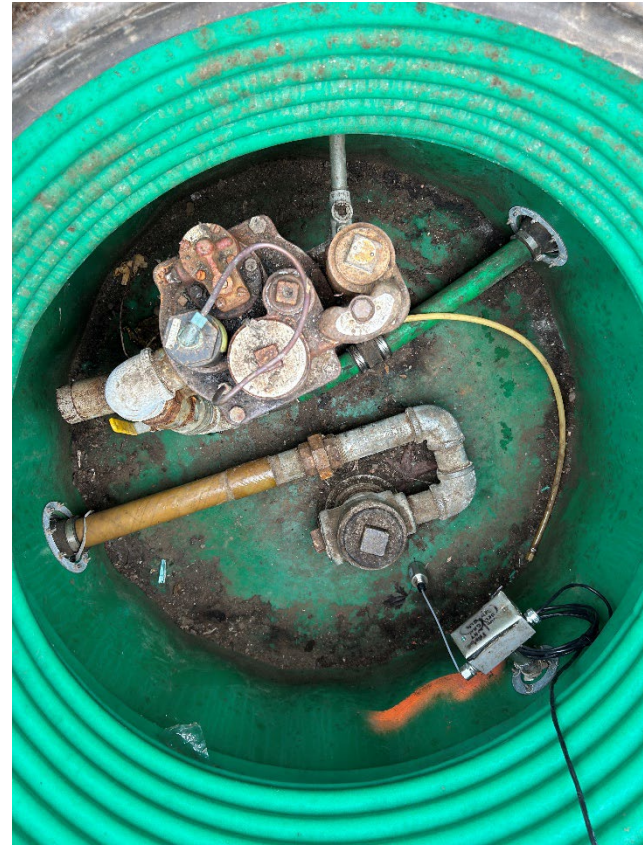

10: Clean premium sump

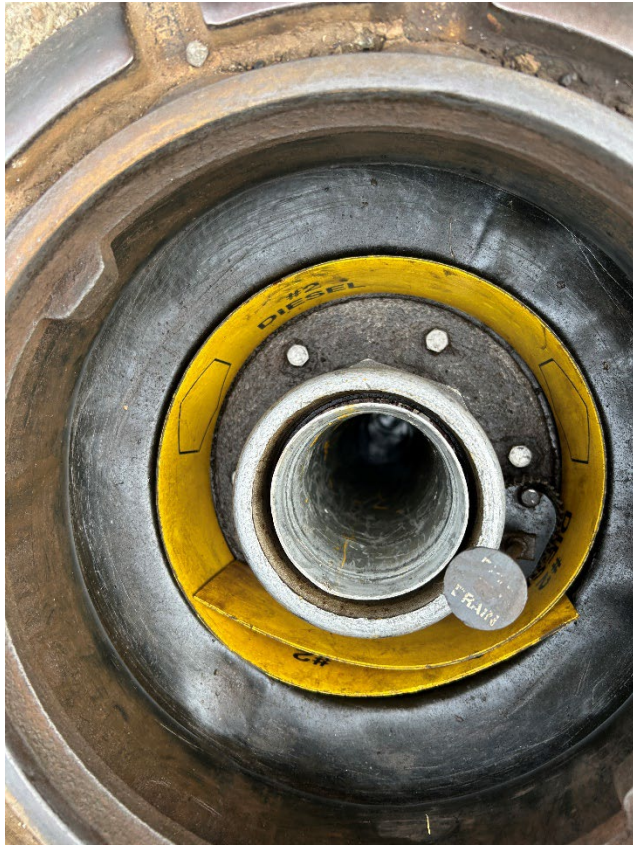

11: Diesel fill



12: Diesel tank gauge probe




13: Diesel sump



14: Unleaded regular fill with coxial drop tube



15: Regular tank gauge probe

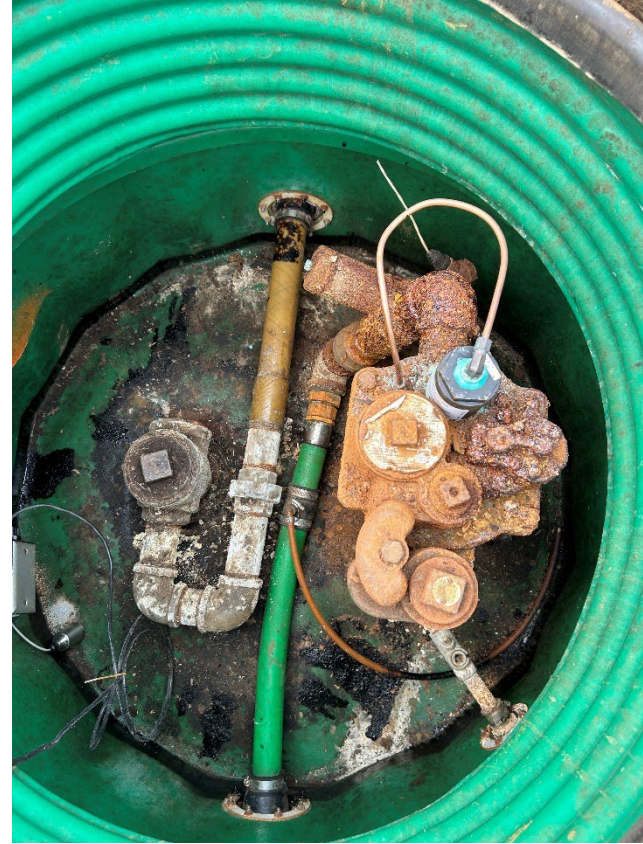

16: Regular sump




17:UDC #1/2



18: UDC #3/4



19: UDC #5/6

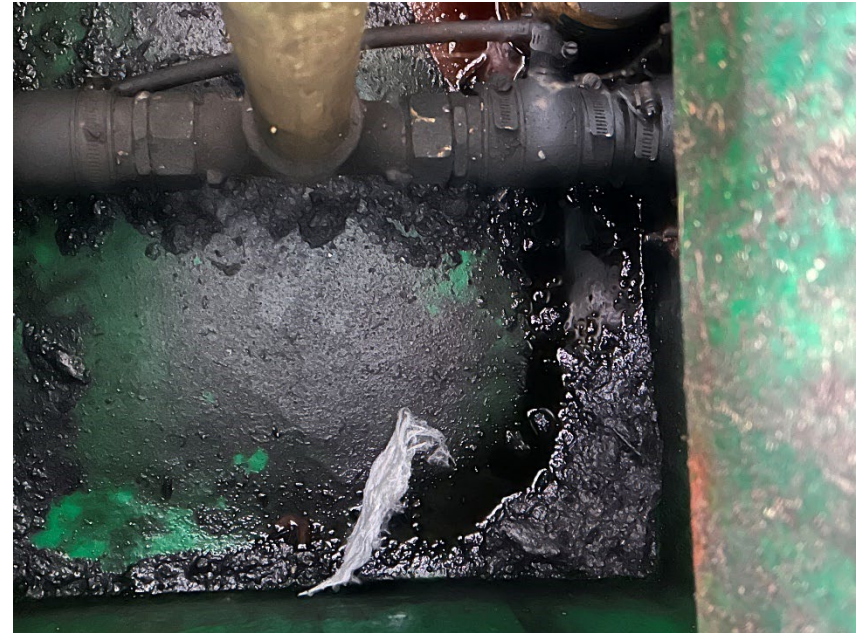

20: UDC #7/8



**21: UDC #7/8 with filter oil in bottom**



This section for DEQ use only

State of Oregon  
Department of  
Environmental  
Quality

Department of Environmental Quality  
Underground Storage Tank Program

Field Citation  
For UST Violations

DEQ Information		UST Facility Information	
Inspection Date:	09/09/2025	Facility ID#:	1207
Inspector:	Ingrid GAFFNEY	Facility Name:	CANBY FOOD MARKET
DEQ Office:	700 NE Multnomah St Ste 600	Facility Address:	293 SW 1ST AVE, CANBY, Oregon 97013
Phone #:	503-229-5048	County:	Clackamas

Oregon DEQ inspected the facility listed above and identified the UST violations listed on page 3 of this Field Citation.

Field Citation Issued:	<input type="checkbox"/> In Person	<input checked="" type="checkbox"/> By Email	<input type="checkbox"/> Both	Date Issued: 09/17/2025
Facility Representative Present During Inspection:	Daljit (Rocky) Singh		<input type="checkbox"/> Permittee <input type="checkbox"/> Owner <input type="checkbox"/> Other	
Name of Permittee or Owner:	DS Canby LLC			
Mailing Address:	4495 River Rd N , Keizer Oregon 97303			

**Field Citation Penalty** – See Page 3 for a detailed listing of each violation. \$ 450

**Check payable to: DEQ Financial Services LBX3615; P.O. Box 3615; Portland OR 97208-3615**

**Or pay online through your YDO account**

**This Field Citation is issued in accordance with the requirements for the expedited enforcement of Underground Storage Tank (UST) violations, OAR 340-150-0250.**

**Owner or Permittee should select Option 1 or Option 2 below and return a signed copy of this form to DEQ by the following date: 10/13/2025**

DEQ Revenue Section  
700 NE Multnomah St. #600  
Portland, Oregon 97232

**Check one option**

- Option 1** - I acknowledge that the listed violation(s) have occurred, and I am remitting the listed field citation penalty.
- Option 2** - I do not want to participate in the expedited enforcement process and understand that my file will be referred to the Department's Office of Compliance and Enforcement for formal enforcement action.

Name:	Owner / Permittee
Signature:	Date:

**Important**

**Read pages 2 and 3 for more information about your options and a detailed listing of violations and compliance requirements.**

### Field Citation Requirements

The permittee or owner should select Option 1 or Option 2 and return a signed copy of Page 1 of the Field Citation form within thirty (30) days of issuance of the Field Citation. If the permittee or owner fails to sign and send Page 1 of the Field Citation form back or pay the penalty within thirty days, Option 1 expires, the Field Citation will serve as a Pre-Enforcement Notice (PEN) and the permittee and owner will be subject to formal enforcement, including the imposition of civil penalties in accordance with OAR Chapter 340, Division 12.

The permittee or owner must complete the actions required to correct the violations listed on the Field Citation by the date specified to prevent further enforcement action by DEQ.

#### **Option 1:**

By checking Option 1, the permittee or owner acknowledges that the violations listed on Page 3 of this Field Citation have occurred and agrees to pay the established penalty.

By submitting payment of the penalty amount, the responding permittee or owner agrees to accept the field citation as a final order of the Environmental Quality Commission (commission) and waives any and all rights and objections to the form, content, manner of service and timeliness of the Field Citation; to a contested case hearing and judicial review of the Field Citation [OAR 340-150-0250(6)]; and to service of a copy of this Final Order (*i.e.*, no other copy will be provided).

Upon the Department's receipt of payment of the penalty amount set forth in the Field Citation, the Field Citation becomes a Final Order of the Commission that:

1. Imposes upon the permittee or owner a civil penalty in the amount listed on Page 1 of this Field Citation; and
2. Requires the permittee or owner to satisfactorily complete the requirements and actions necessary to correct the violations documented by the dates set forth on Page 3 of this Field Citation.

Failure by the permittee or owner to complete the actions set forth on Page 3 of the Field Citation by the specified date violates the Commission Order and subjects the permittee and owner to a formal enforcement action, including the imposition of additional civil penalties.

#### **Option 2:**

The permittee or owner may deny that the violations as listed on Page 3 of this Field Citation have occurred or contest the Field Citation process by checking Option 2 and submitting to the Department a signed copy of Page 1 of the Field Citation. In that event, the Field Citation will serve as a Pre-Enforcement Notice (PEN) and the permittee and owner will be subject to formal enforcement for those violations set forth in the Field Citation, including the imposition of civil penalties in accordance with OAR Chapter 340, Division 12. Civil penalties that will be imposed by the formal enforcement process will exceed the Field Citation penalties for the same violation(s).

**The Department appreciates your cooperation and efforts to comply with the regulations for underground storage tank systems.**

**UST FIELD CITATION**

DATE ISSUED: 09/17/2025

PROGRAM ENFORCEMENT No.: 2025-FC-9994

FACILITY ID: 1207

Page 3 of 3

**Violation #1:** (J5.7a) Failure to maintain adequate records of ATG monitoring and testing results.  
**\*TCR:**

Corrective Action: Submit results of most recent month's records within 10 days of the next month. Submit remainder of September's and October's leak detection reports and submit to DEQ by October 13, 2025

Rule Citation: <b>OAR 340-150-0450(5)</b>	Penalty Amount: \$ 300	Correct Violation by: 10/13/2025	Date Violation Corrected:
---	------------------------	----------------------------------	---------------------------

**Violation #2:** Failure to install, operate, maintain or calibrate RD equipment per manufacturer's instructions, including service checks for operability or running condition  
**\*TCR:** (i.e. device has been incorrectly installed, is defective, damaged, or may have been tamp

Corrective Action: Provide DEQ with tank gauge set-up report, certification that the tank gauge is functioning, and leak detection reports demonstrating the system is printing correct dates and times. Submit to DEQ by October 13, 2025

Rule Citation: <b>OAR 340-150-0400(1)(c)</b>	Penalty Amount: \$ 150	Correct Violation by: 10/13/2025	Date Violation Corrected:
--	------------------------	----------------------------------	---------------------------

**Violation #3:**  
**\*TCR:**

Corrective Action:

Rule Citation: <b>OAR</b>	Penalty Amount: \$	Correct Violation by:	Date Violation Corrected:
---------------------------	--------------------	-----------------------	---------------------------

**Violation #4:**  
**\*TCR:**

Corrective Action:

Rule Citation: <b>OAR</b>	Penalty Amount: \$	Correct Violation by:	Date Violation Corrected:
---------------------------	--------------------	-----------------------	---------------------------

**Violation #5:**  
**\*TCR:**

Corrective Action:

Rule Citation: <b>OAR</b>	Penalty Amount: \$	Correct Violation by:	Date Violation Corrected:
---------------------------	--------------------	-----------------------	---------------------------

**Violation #6:**  
**\*TCR:**

Corrective Action:

Rule Citation: <b>OAR</b>	Penalty Amount: \$	Correct Violation by:	Date Violation Corrected:
---------------------------	--------------------	-----------------------	---------------------------

Total Penalty Amount: \$ 450			
------------------------------	--	--	--

**YOU MUST CORRECT THE VIOLATIONS AS REQUIRED, ENTER THE DATES CORRECTED, SIGN THE STATEMENT BELOW, AND**

**RETURN THIS FORM TO THE DEQ INSPECTOR LISTED ON PAGE 1 ON OR BEFORE: 10/13/2025**

**Retain a copy of this form and all documentation of corrective actions for your records.**

*I hereby certify that the UST violations noted above have been corrected:* \_\_\_\_\_ / \_\_\_\_\_

Permittee/Owner Signature

Date



**SERVICE ORDER**

514580

- PORTLAND  
435 N.E. HANCOCK  
PORTLAND, OR 97212  
503-282-2587
- TRICITIES  
200 S. 20TH AVE.  
PASCO, WA 99301  
509-543-2018
- SEATTLE  
6530 5TH PLACE SOUTH  
SEATTLE, WA 98108  
206-763-7867
- ANCHORAGE AK  
ANCHORAGE AK  
907-242-3921

ACCOUNT NUMBER <b>CODP-837</b>		JOB SITE ORDER DATE: 09/09/2025 JOB PHONE: _____ WORK ORDERED BY: _____	
SOLD TO: <b>CANBY FOOD MART</b>		JOB NAME: <b>CANBY FOOD MART</b>	
ADDRESS: <b>293 SW 1ST AVE</b>		ADDRESS: <b>293 SW 1ST AVE</b>	
CITY: <b>CANBY</b>	STATE: <b>OR</b>	CITY: <b>CANBY</b>	STATE: <b>OR 97013</b>

CUSTOMER P.O. NUMBER <b>ROCKY 971-273-3635</b>	LP	TECHNICIAN	MFG. AUTHORIZATION (if necessary)
MODEL	SERIAL NUMBER	MODEL	SERIAL NUMBER

PROBLEM REPORTED: EMERGENCY EVO200 NOT SHOWING CORRECT DATE, SITE LOST PASSWORD SITE FACING INSPECTION, MAY BE SHUT DOWN IF EVO200 IS NOT CORRECTED

MATERIAL USED					
QTY.	WH	PART NUMBER	DESCRIPTION	PRICE	AMOUNT

TIME ARRIVED **1:15** AM PM (circle one)      TIME DEPARTED **3:00** AM PM (circle one)      Customer Initials \_\_\_\_\_

WORK DESCRIPTION: Contacted Franklin fueling in order to gain access to reset password on Evo200. After the password reset, I then changed the date and time from March 2022 to the current date. Tank monitor went into alarm for tank compliance due to date/time change. The site is running SCALD, and the alarm will clear after a passing test. There were no compliance alarms before the date/time change. While on the phone with Franklin, we performed a firmware upgrade due to old software. Tank monitor loaded without issue and is displaying correct time, date, and firmware. If date/time issue returns, we will need to replace the main board part # (FMSP-24MB). Evo200 does not use a backup battery it uses a capacitor on the main board.

WARRANTY       COMPLETE       PENDING

SERVICEMAN	CHARGES	QTY.	RATE	AMOUNT
<b>Junior Parker</b>	STANDARD LABOR	1.75	125.00	218.75
	OVERTIME LABOR			
	TRAVEL TIME	1		189.10
DATE COMPLETED <b>09/15/2025</b>	MILEAGE			
TERMS:	TOTAL MATERIAL			
	MISC. MATERIAL			
PRINT CUSTOMER NAME	LAP TOP FEE	1	33.00	33.00
CUSTOMER AUTHORIZED SIGNATURE	SUB TOTAL			440.85
	SALES TAX			2.20
	<b>TOTAL AMOUNT DUE</b>			<b>443.05</b>



---

**Re: Oregon DEQ UST Inspection Determination: Canby Food Market #**

---

**From** UST Duty Officer \* DEQ <UST.DutyOfficer@DEQ.oregon.gov>

**Date** Mon 12/15/2025 9:12 AM

**To** Daljit Singh <canbyfoodmart@gmail.com>; UST Duty Officer \* DEQ <UST.DutyOfficer@deq.oregon.gov>

Good morning,

The UST inspection for facility 1207 Canby Food Market located at 293 SW 1<sup>st</sup> ave. Canby, OR is **officially CLOSED and COMPLETE.**

Thank you for the communication throughout this process and keeping your facility in compliance with Oregon rules and regulations.



**Emily Litke** (she/her)

Duty Officer, Underground Storage Tanks

DEQ Headquarters, Land Quality Division

700 NE Multnomah Street, Suite 600

Portland OR 97232-4100

503-806-9516

[Emily.LITKE@deq.oregon.gov](mailto:Emily.LITKE@deq.oregon.gov)

---

**From:** Daljit Singh <canbyfoodmart@gmail.com>

**Sent:** Tuesday, December 2, 2025 11:13 AM

**To:** UST Duty Officer \* DEQ <UST.DutyOfficer@deq.oregon.gov>

**Subject:** Re: Oregon DEQ UST Inspection Determination: Canby Food Market #

I have mailed the check last week. You should receive it in the next few days.

On Tue, Dec 2, 2025 at 11:00 AM UST Duty Officer \* DEQ <[UST.DutyOfficer@deq.oregon.gov](mailto:UST.DutyOfficer@deq.oregon.gov)> wrote:

Thanks for sending that image- that looks great. As soon as payment of the \$450 penalty is received, then this UST inspection can be closed.

**Payment of Field Citation Penalty Instructions**

Payment can be made either through **check** or **online** through Your DEQ Online – follow the link below to create an account.

[Getting Started with Your DEQ Online](#) - link to create account and how-to tutorials

[PaymentsforEEOs.pdf](#) – step by step instructions for submitting payments online

\*\*\*I also noticed that the pollution liability insurance policy that the DEQ has listed for this facility, expired on 6/3/25. Please upload the renewed policy as a "Financial Responsibility Submittal" to Your DEQ Online.\*\*\*

[UST Financial Responsibility Submittal](#) - step by step instructions for financial responsibility submittal



**Emily Litke**\_(she/her)

Duty Officer, Underground Storage Tanks

DEQ Headquarters, Land Quality Division

[700 NE Multnomah Street, Suite 600](#)

[Portland OR 97232-4100](#)

503-806-9516

[Emily.LITKE@deq.oregon.gov](mailto:Emily.LITKE@deq.oregon.gov)

---

**From:** Daljit Singh <[canbyfoodmart@gmail.com](mailto:canbyfoodmart@gmail.com)>

**Sent:** Tuesday, November 25, 2025 3:49 PM

**To:** UST Duty Officer \* DEQ <[UST.DutyOfficer@deq.oregon.gov](mailto:UST.DutyOfficer@deq.oregon.gov)>

**Subject:** Re: Oregon DEQ UST Inspection Determination: Canby Food Market #

Canby Food Mart  
293 SW 1ST Ave  
Canby Oregon 97013  
503-266-8095

TANK TEST REPORT  
Last Available

Oct 23, 2025, 8:29:45 PM

Copyright © 2004-2025 Franklin Electric. All rights reserved. Version 3.2B.1

SCALD Tests

Tank 1

Product : Non Ethanol Premium	Capacity : 10,000.0 gal
Start Time	10/6/25 18:50
End Time	10/21/25 18:53
Result	Pass
Slope	0.02 gph
Test Time	1,007 min
Average Volume	3,641.3 gal
Test Confidence	95%
Volume Qualify	14%

Tank 2

Product : Diesel	Capacity : 10,000.0 gal
Start Time	10/10/25 00:21
End Time	10/23/25 05:21
Result	Pass
Slope	0.03 gph
Test Time	987 min
Average Volume	3,477.1 gal
Test Confidence	95%
Volume Qualify	14%

Tank 3

Product : Unleaded	Capacity : 10,000.0 gal
Start Time	10/6/25 23:44
End Time	10/22/25 00:19
Result	Pass
Slope	0.12 gph
Test Time	437 min
Average Volume	4,679.4 gal
Test Confidence	95%
Volume Qualify	14%

Static Tests

Tank 1

Product : Non Ethanol Premium	Capacity : 10,000.0 gal
No results available	

Tank 2

Product : Diesel	Capacity : 10,000.0 gal
No results available	

Tank 3

Product : Unleaded	Capacity : 10,000.0 gal
No results available	

On Tue, Nov 25, 2025 at 3:47 PM UST Duty Officer \* DEQ <[UST.DutyOfficer@deq.oregon.gov](mailto:UST.DutyOfficer@deq.oregon.gov)> wrote:

Good afternoon,  
UST facility 1207 Canby Food Mart located at [293 SW 1st Ave Canby, OR](#)

Thanks for chatting with me on the phone this afternoon.

Corrective Actions: (email requested items)

1. Submit results of most recent month's records within 10 days of the next month. Submit remainder of September's and October's leak detection reports and submit to DEQ by October 13, 2025
2. Provide DEQ with tank gauge set-up report, certification that the tank gauge is functioning ~~and repair reports from service provider~~ (received mascot invoice 9/15/25), and leak detection reports demonstrating the system is printing correct dates and times. Submit to DEQ by October 13, 2025

**Payment of Field Citation Penalty Instructions**

Payment can be made either through **check** or **online** through Your DEQ Online – follow the link below to create an account.

[Department of Environmental Quality : Welcome to Your DEQ Online : Online Services : State of Oregon](#)

[PaymentsforEEOs.pdf](#) – step by step instructions for submitting payments online

**\*\*\*I also noticed that the pollution liability insurance policy that the DEQ has listed for this facility, expired on 6/3/25. Please upload the renewed policy as a "Financial Responsibility Submittal" to Your DEQ Online.\*\*\***

[UST Financial Responsibility Submittal](#) - step by step instructions for financial responsibility submittal



**Emily Litke**\_(she/her)

Duty Officer, Underground Storage Tanks

DEQ Headquarters, Land Quality Division

[700 NE Multnomah Street, Suite 600](#)

[Portland OR 97232-4100](#)

503-806-9516

[Emily.LITKE@deq.oregon.gov](mailto:Emily.LITKE@deq.oregon.gov)

---

**From:** LITKE Emily \* DEQ <[Emily.LITKE@deq.oregon.gov](mailto:Emily.LITKE@deq.oregon.gov)>

**Sent:** Thursday, November 6, 2025 10:29 AM

**To:** UST Duty Officer \* DEQ <[UST.DutyOfficer@DEQ.oregon.gov](mailto:UST.DutyOfficer@DEQ.oregon.gov)>;  
[canbyfoodmart@gmail.com](mailto:canbyfoodmart@gmail.com) <[canbyfoodmart@gmail.com](mailto:canbyfoodmart@gmail.com)>

**Subject:** Re: Oregon DEQ UST Inspection Determination: Canby Food Market #

Good morning,

UST facility 1207 Canby Food Mart located at [293 SW 1st Ave Canby, OR](#)

**Please provide an update on the payment of the \$450 penalty and completion of the corrective actions, the deadline was 10/13/25.**

This UST inspection will remain open with the option for escalation as a referral to the Office of Compliance and Enforcement if no action is taken.

Corrective Actions:

1. Submit results of most recent month's records within 10 days of the next month. Submit remainder of September's and October's leak detection reports and submit to DEQ by October 13, 2025
2. Provide DEQ with tank gauge set-up report, certification that the tank gauge is functioning and repair reports from service provider (received mascot invoice 9/15/25), and leak detection reports demonstrating the system is printing correct dates and times. Submit to DEQ by October 13, 2025

**Payment of Field Citation Penalty Instructions**

Payment can be made either through **check** or **online** through Your DEQ Online – follow the link below to create an account.

[Department of Environmental Quality : Welcome to Your DEQ Online : Online Services : State of Oregon](#)

[PaymentsforEEOs.pdf](#) – step by step instructions for submitting payments online

**\*\*\*I also noticed that the pollution liability insurance policy that the DEQ has listed for this facility, expired on 6/3/25. Please upload the renewed policy as a "Financial Responsibility Submittal" to Your DEQ Online. This is a courtesy reminder and in the future you will be issued a \$50 late penalty.\*\*\***

[UST Financial Responsibility Submittal](#) - step by step instructions for financial responsibility submittal



**Emily Litke** (she/her)

Duty Officer, Underground Storage Tanks

DEQ Headquarters, Land Quality Division

[700 NE Multnomah Street, Suite 600](#)

[Portland OR 97232-4100](#)

503-806-9516

[Emily.LITKE@deq.oregon.gov](mailto:Emily.LITKE@deq.oregon.gov)

---

**From:** UST Duty Officer \* DEQ <[UST.DutyOfficer@DEQ.oregon.gov](mailto:UST.DutyOfficer@DEQ.oregon.gov)>  
**Sent:** Monday, October 20, 2025 5:15 PM  
**To:** UST Duty Officer \* DEQ <[UST.DutyOfficer@DEQ.oregon.gov](mailto:UST.DutyOfficer@DEQ.oregon.gov)>;  
[canbyfoodmart@gmail.com](mailto:canbyfoodmart@gmail.com) <[canbyfoodmart@gmail.com](mailto:canbyfoodmart@gmail.com)>  
**Subject:** Re: Oregon DEQ UST Inspection Determination: Canby Food Market #

Good afternoon,  
UST facility 1207 Canby Food Mart located at [293 SW 1st Ave Canby, OR](#)

**Please provide an update on the payment of the \$450 penalty and completion of the corrective actions, the deadline was 10/13/25.**

Corrective Actions:

1. Submit results of most recent month's records within 10 days of the next month. Submit remainder of September's and October's leak detection reports and submit to DEQ by October 13, 2025
2. Provide DEQ with tank gauge set-up report, certification that the tank gauge is functioning ~~and repair reports from service provider~~ (received mascot invoice 9/15/25), and leak detection reports demonstrating the system is printing correct dates and times. Submit to DEQ by October 13, 2025

**Payment of Field Citation Penalty Instructions**

Payment can be made either through **check** or **online** through Your DEQ Online – follow the link below to create an account.

[Department of Environmental Quality : Welcome to Your DEQ Online : Online Services : State of Oregon](#)

[PaymentsforEEOs.pdf](#) – step by step instructions for submitting payments online



**Emily Litke** (she/her)

Duty Officer, Underground Storage Tanks

DEQ Headquarters, Land Quality Division

[700 NE Multnomah Street, Suite 600](#)

[Portland OR 97232-4100](#)

503-806-9516

[Emily.LITKE@deq.oregon.gov](mailto:Emily.LITKE@deq.oregon.gov)

---

**From:** LITKE Emily \* DEQ <[Emily.LITKE@deq.oregon.gov](mailto:Emily.LITKE@deq.oregon.gov)>  
**Sent:** Monday, October 13, 2025 10:13 AM  
**To:** UST Duty Officer \* DEQ <[UST.DutyOfficer@DEQ.oregon.gov](mailto:UST.DutyOfficer@DEQ.oregon.gov)>;  
[canbyfoodmart@gmail.com](mailto:canbyfoodmart@gmail.com) <[canbyfoodmart@gmail.com](mailto:canbyfoodmart@gmail.com)>  
**Subject:** Re: Oregon DEQ UST Inspection Determination: Canby Food Market #

Good morning,

UST facility 1207 Canby Food Mart located at 293 SW 1<sup>st</sup> Ave Canby, OR

This is a reminder that the deadline for payment of the \$450 penalty and documentation for the corrective actions is today, 10/13/25

Corrective Actions:

1. Submit results of most recent month's records within 10 days of the next month. Submit remainder of September's and October's leak detection reports and submit to DEQ by October 13, 2025
2. Provide DEQ with tank gauge set-up report, certification that the tank gauge is functioning ~~and repair reports from service provider~~ (received mascot invoice 9/15/25), and leak detection reports demonstrating the system is printing correct dates and times. Submit to DEQ by October 13, 2025

**Payment of Field Citation Penalty Instructions**

Payment can be made either through **check** or **online** through Your DEQ Online – follow the link below to create an account.

[Department of Environmental Quality : Welcome to Your DEQ Online : Online Services : State of Oregon](#)

[PaymentsforEEOs.pdf](#) – step by step instructions for submitting payments online



**Emily Litke** (she/her)

Duty Officer, Underground Storage Tanks

DEQ Headquarters, Land Quality Division

[700 NE Multnomah Street, Suite 600](#)

[Portland OR 97232-4100](#)

503-806-9516

[Emily.LITKE@deq.oregon.gov](mailto:Emily.LITKE@deq.oregon.gov)

---

**From:** UST Duty Officer \* DEQ <[UST.DutyOfficer@DEQ.oregon.gov](mailto:UST.DutyOfficer@DEQ.oregon.gov)>  
**Sent:** Wednesday, September 17, 2025 11:07 AM  
**To:** [canbyfoodmart@gmail.com](mailto:canbyfoodmart@gmail.com) <[canbyfoodmart@gmail.com](mailto:canbyfoodmart@gmail.com)>  
**Cc:** UST Duty Officer \* DEQ <[UST.DutyOfficer@DEQ.oregon.gov](mailto:UST.DutyOfficer@DEQ.oregon.gov)>  
**Subject:** Re: Oregon DEQ UST Inspection Determination: Canby Food Market #

Good morning,

Please review the attached field citation. The deadline for payment of the \$450 penalty and completion of the corrective actions is 10/13/25.

Corrective Actions:

1. Submit results of most recent month's records within 10 days of the next month. Submit remainder of September's and October's leak detection reports and submit to DEQ by October 13, 2025
2. Provide DEQ with tank gauge set-up report, certification that the tank gauge is functioning ~~and repair reports from service provider~~ (received mascot invoice 9/15/25), and leak detection reports demonstrating the system is printing correct dates and times. Submit to DEQ by October 13, 2025

**Payment of Field Citation Penalty Instructions**

Payment can be made either through **check** or **online** through Your DEQ Online – follow the link below to create an account.

[Department of Environmental Quality : Welcome to Your DEQ Online : Online Services : State of Oregon](#)

[PaymentsforEEOs.pdf](#) – step by step instructions for submitting payments online

Questions about online payments and submittals can be directed to the Help Desk at

[itservicedesk@deq.oregon.gov](mailto:itservicedesk@deq.oregon.gov) or

[Your DEQ Online Helpdesk - Jira Service Management](#) –



**Emily Litke** (she/her)

Duty Officer, Underground Storage Tanks

DEQ Headquarters, Land Quality Division

[700 NE Multnomah Street, Suite 600](#)

[Portland OR 97232-4100](#)

503-806-9516

[Emily.LITKE@deq.oregon.gov](mailto:Emily.LITKE@deq.oregon.gov)

---

**From:** GAFFNEY Ingrid \* DEQ <[Ingrid.GAFFNEY@deq.oregon.gov](mailto:Ingrid.GAFFNEY@deq.oregon.gov)>  
**Sent:** Tuesday, September 16, 2025 9:59 AM  
**To:** [canbyfoodmart@gmail.com](mailto:canbyfoodmart@gmail.com) <[canbyfoodmart@gmail.com](mailto:canbyfoodmart@gmail.com)>  
**Cc:** UST Duty Officer \* DEQ <[UST.DutyOfficer@DEQ.oregon.gov](mailto:UST.DutyOfficer@DEQ.oregon.gov)>; LITKE Emily \* DEQ <[Emily.Litke@deq.oregon.gov](mailto:Emily.Litke@deq.oregon.gov)>  
**Subject:** Oregon DEQ UST Inspection Determination: Canby Food Market #

Hi Canby Food Mart (Rocky):

Thank you for meeting with DEQ to perform the inspection at 293 SW 1<sup>st</sup> Ave, Canby, OR 97013 on September 9, 2025.

Since DEQ observed violations, enforcement will be issued per the enforcement guidance. Below are the listed violations.

You will receive the enforcement documentation via a separate email from the UST Duty officer email. The payment can be made via [Your DEQ Online Website](#).

**\*Please email the UST duty officer from this point forward with all communications about the violation or when sending over the final testing records and any repair documentation. DO NOT SEND THEM TO ME. Contact the UST Duty Officer at 503-229-5034 or [ust.dutyofficer@deq.oregon.gov](mailto:ust.dutyofficer@deq.oregon.gov)**

**Violations:**

1. J5.7a – Failing to maintain adequate records of leak detection reports from the tank gauge system. Missing a year's worth of leak detection records. 340-150-0450(5)
2. H2.5 – Failure to maintain or calibrate the tank gauge/release detection equipment per manufacturer's instructions, including running condition annually (device has been incorrectly installed, is defective, damaged or may have been tampered with in a manner that prevents proper operation. 340-150-0400(1)(c)

**Corrective Actions:**

1. Submit results of most recent month's records within 10 days of the next month. Submit remainder of September's and October's leak detection reports and submit to DEQ by **October 13, 2025 via the UST Duty officer email: [ust.dutyofficer@deq.oregon.gov](mailto:ust.dutyofficer@deq.oregon.gov)**
2. Provide DEQ with tank gauge set-up report, certification that the tank gauge is functioning and repair reports from service provider, and leak detection reports to the UST Duty officer demonstrating the system is printing correct dates and times. Submit to DEQ by **October 13, 2025 via the UST Duty officer email: [ust.dutyofficer@deq.oregon.gov](mailto:ust.dutyofficer@deq.oregon.gov)**

Emily – This site has had Mascott come to repair the and reprogram the ATG. Attached is photo of the work order receipt.



SERVICE ORDER

- PORTLAND  
435 N.E. HANCOCK  
PORTLAND, OR 97212  
503-282-2587
- TRICITIES  
200 S. 20TH AVE.  
PASCOWA, WA 99301  
509-843-2018
- SEATTLE  
6530 8TH PLACE SOUTH  
SEATTLE, WA 98108  
206-763-7867
- ANCHORAGE  
ANCHORAGE, AK  
907-242-3921

514580

ACCOUNT NUMBER: **CODP-837**

SOLD TO: **CANBY FOOD MART**

ADDRESS: **293 SW 1ST AVE**

CITY: **CANBY** STATE: **OR**

JOB SITE: **CANBY FOOD MART**

ORDER DATE: **09/09/2025**

WORK ORDERED BY:

JOB NAME: **CANBY FOOD MART**

ADDRESS: **293 SW 1ST AVE**

CITY: **CANBY** STATE: **OR 97013**

CUSTOMER P.O. NUMBER: **ROCKY 971-273-3635**

TECHNICIAN: **LP**

MFG AUTHORIZATION (if necessary):

MODEL: SERIAL NUMBER: MODEL: SERIAL NUMBER:

PROBLEM REPORTED: EMERGENCY EVO200 NOT SHOWING CORRECT DATE, SITE LOST PASSWORD SITE FACING INSPECTION, MAY BE SHUT DOWN IF EVO200 IS NOT CORRECTED

MATERIAL USED					
QTY.	WH	PART NUMBER	DESCRIPTION	PRICE	AMOUNT

TIME ARRIVED: **1:15** AM PM (circle one)      TIME DEPARTED: **3:00** AM PM (circle one)      Customer Initials: \_\_\_\_\_

WORK DESCRIPTION: Contacted Franklin fueling in order to gain access to reset password on Evo200. After the password reset, I then changed the date and time from March 2022 to the current date. Tank monitor went into alarm for tank compliance due to date/time change. The site is running SCALD, and the alarm will clear after a passing test. There were no compliance alarms before the date/time change. While on the phone with Franklin, we performed a firmware upgrade due to old software. Tank monitor loaded without issue and is displaying correct time, date, and firmware. If date/time issue returns, we will need to replace the main board part # (FMSP-24MB). Evo200 does not use a backup battery it uses a capacitor on the main board.

WARRANTY       COMPLETE       PENDING

	CHARGES	QTY.	RATE	AMOUNT
SERVICEMAN: <b>Junior Parker</b>	STANDARD LABOR	1.75	125.00	218.75
	OVERTIME LABOR			
	TRAVEL TIME	1		189.10
DATE COMPLETED: <b>09/15/2025</b>	MILEAGE			
TERMS:	TOTAL MATERIAL			
PRINT CUSTOMER NAME	MISC. MATERIAL			
CUSTOMER AUTHORIZED SIGNATURE	LAP TOP FEE	1	33.00	33.00
	SUB TOTAL			440.85
	SALES TAX			2.20
	<b>TOTAL AMOUNT DUE</b>			<b>443.05</b>



Regards,

Ingrid Gaffney  
UST Compliance Inspector  
DEQ UST Program  
[700 NE Multnomah St, Ste 600](#)  
[Portland, OR 97232](#)  
503-875-1246  
<https://www.oregon.gov/deq/Pages/index.aspx>  
*she/ her*

Fee - Paid = Due  
\$ 450.00 - \$ 450.00 = \$ 0.00

Penalty

▶ 2025-fc-9994

ⓘ UST - Field Citation

\$ 450.00

1 Results

⊕ Add Penalty

➡ Send to FIMS

Payment

▼ Check by Mail 8459

📅 12/12/2025

\$ 450.00

ⓘ 62506

Type

Check by Mail

Amount

450

E-Payment Confirmation#

E-Payment Settle Date

mm/dd/yyyy



Ref#

62506

Payment Date

12/12/2025



Comments

2025-FC-9994

(Remaining Length: 3988)

Site Info

CANBY FOOD MARKET



Google

📍 293 SW 1ST AVE, CANBY, OR 97013

ⓘ 63981 ✓

ⓘ 273687

ⓘ CEM\_FacilityIdentifier=18743 UST (1207)

📁 Stationary

Inspection Info

10630 Completed

☰ UST

📁 Full Compliance Inspection (FCI) TCR only

📅 Start Date 9/9/2025

📅 End Date 9/9/2025

Created & Updated Info